

CANADAN CHESTSON TO CHANGE IN PARAMANT RECORDED TRECORDED DANADAN DISCOUNTED

WHOI-87-54


Technical Activities Associated with the ZONAL Pacific Array

by

George H. Tupper

Woods Hole Oceanographic Institution Woods Hole, Massachusetts 02543

December 1987

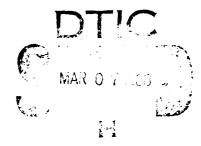

Technical Report

Funding was provided by the Office of Naval Research under contract Numbers N00014-76-C-0197, NR 083-400, and N00014-84-C-0134, NR 083-400.

Reproduction in whole or in part is permitted for any purpose of the United States Government. This report should be cited as:
Woods Hole Oceanog. Inst. Tech. Rept., WHOI-87-54.

Approved for publication; distribution unlimited.

Approved for Distribution:

Robert C. Beardsley, Chairman

Department of Physical Oceanography

Robert C Beardsley

Table of Contents

		Page No
Abstract		1
Section I SCIENTIFIC BACKGROUND		2
Section II TECHNICAL BACKGROUND		6
A. Moorings		6
B. Instrumentation		15
Geodyne Model 850 Current Meter		15
Vector-Averaging Current Meter (VACM)		21
Vector-Measuring Current Meter (VMCM)		26
Section III CRUISES		30
1983 Cruise - 17 Oct-10 Dec 83		30
Leg I		31
Leg II		32
1984 Cruise - 19 Sep-3 Nov 84		47
Leg I		47
Leg II		53
1985 Cruise - 24 Sep-2 Nov 85		58
Leg I	DTIC	58
Leg II	COPY INSPECTED 1	61
Section IV RESULTS, IMPROVEMENTS, PROBLEMS	Accession For	68
A. Data Return	NOTE I PAT	68
B. Wire Re-use	DEL VIETA	68
C. Release Tracking Using PGR and Towfish	1 100, 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	70
ii	DI	

	Page No.
D. Release Problems	71
Release Implosion	71
Release Actuation after Deployment	71
Release Firing after Mooring Recovery	72
Release Failure	72
E. VMCM Problems	73
ZONAL - VMCM Rotor Report (Valdes)	74
Section V ZONAL MOORING DRAWINGS	81
Acknowledgements	110
Peferences	111

	List of Figures	Page No.
Fig. 1	Recent Mooring Locations in the North Pacific	4
Fig. 2	Typical WHOI Intermediate Mooring	7
Fig. 3	Typical WHOI Syntactic Sphere Mooring	8
Fig. 4	Intermediate Mooring Performance ~ Eastern Current Profile	10
Fig. 5	Intermediate Mooring Performance - Western Current Profile	11
Fig. 6	Syntactic Sphere Mooring Performance - Western Current Profile	12
Fig. 7	ZONAL Mooring Array	13
Fig. 8	Geodyne 850 Current Meter	16
Fig. 9	Data Format, 850 Current Meter	19
Fig. 10	Vector-Averaging Current Meter (VACM)	22
Fig. 11	Vector-Measuring Current Meter (VMCM)	27
Fig. 12	Taft Mooring A	36
Fig. 13	Taft Mooring B	37
Fig. 14	Taft Mooring C	38
Fig. 15	Taft Mooring D	39
Fig. 16	Taft Mooring A failure and dragging procedure	40
Fig. 17	Cruise Track, R/V Thomas G. Thompson Cruise No. 177, 17 Oct 83 - 10 Dec 83	41
Fig. 18	Cruise Track, R.V Thomas G. Thompson Cruise No. 184, 19 Sept 84 - 3 Nov 84	48
Fig. 19	Extended Duration Subsurface Mooring	62
Fig. 20	Cruise Track, R/V Thomas G. Thompson Cruise No. 191, 24 Sept 85 - 2 Nov 85	63
Fig. 21	Data Return, ZONAL Pacific Experiment	69
Fig. 22	A VMCM data record from the first year's ZONAL deployment (1983-1984)	75
Fig. 23	A VMCM data record from the second year's ZONAL deployment (1984-1985)	76
	iv	

List of Tables

			Page No
Table	1	North Pacific Mooring Locations - ZONAL Exploration	5
		Fall 1983 - Fall 1985	
Table	2	CTD Stations taken on Leg I of ZONAL Pacific Cruise, Fall 1983	33
Table	3	A Summary of the mooring work conducted during Leg I of the	34
		R/V Thomas G. Thompson Cruise Number 177	
Table	4	R/V Thomas G. Thompson, Cruise 177 Leg I, Seattle, Washington -	35
		Midway Island, 17 Oct 83 - 8 Nov 83 - Personnel	
Table	5	CTD Stations taken on Leg II of ZONAL Pacific Cruise, Fall 1983	44
Table	6	A Summary of the Mooring Work Conducted during Leg II of	45
		R/V Thomas G. Thompson Cruise Number 177	
Table	7	R/V. Thomas G. Thompson, Cruise Number 177 Leg II, Midway Island -	46
		Guam, 10 Nov 83 - 10 Dec 83 - Personnel	
Table	8	CTD Stations taken on Leg I of ZONAL Pacific Cruise, Fall 1984	49
Table	9	A Summary of the Mooring Work conducted during Leg I of	51
		R/V Thomas G. Thompson Cruise Number 184	
Table	10	R/V Thomas G. Thompson, Cruise Number 184 Leg I, Honolulu -	52
		Midway Island, 19 Sep 84 - 16 Oct 84 - Personnel	
Table	11	CTD Stations taken on Leg II of ZONAL Pacific Cruise, Fall 1984	54
Table	12	A Summary of the Mooring Work conducted during Leg II of	55
		R/V Thomas G. Thompson Cruise Number 184	
Table	13	R/V Thomas G. Thompson, Cruise Number 184 Leg II, Midway Island -	56
		Honolulu, 19 Oct 84 - 3 Nov 84 - Personnel	
Table	14	A Summary of the Mooring Work conducted during Leg I of	59
		R/V Thomas G. Thompson Cruise Number 191	
Table	15	R/V Thomas G. Thompson, Cruise Number 191 Leg I, Seattle -	60
		Honolulu, 24 Sep 85 - 5 Oct 85 - Personnel	
Table	16	A Summary of the Mooring Work conducted during Leg II of	64
		R/V Thomas G. Thompson Cruise Number 191	
Table	17	R/V Thomas G. Thompson, Cruise Number 191 Leg II, Honolulu -	65
		Guam. 10 Oct 85 - 2 Nov 85 - Personnel	

ABSTRACT

Geographical exploration of the eddy and mean fields in the world's oceans using moored instrumentation was concentrated in the North Atlantic in the 1970s. Initial efforts to obtain zeroorder coverage in the North Pacific were begun with an array across the Kuroshio Extension along 152°E with instruments in the water from mid-1980 to mid-1982. An array designed to extend this exploration zonally with long-term moorings east of 152°E at mid-latitudes was first set in the fall of 1983, redeployed in the fall of 1984, and recovered for the final time in late 1985. The array was located along four lines of longitude, 165°E, 175°E, 175°W, and 152°W. Along the three westernmost longitudes. 24 one-year moorings were used, 12 each year, with three current meters per mooring at nominal depths of 150, 650, and 4,000 meters. The eastern longitude, 152°E, was sampled by two additional moorings, each with 3 current meters at the above depths, which were deployed for a two-year period. a first for the Buoy Group.

This report addresses the technical activities associated with the 1983-1985 array, referred to hereafter as "ZONAL".

I. SCIENTIFIC BACKGROUND

Observational efforts to obtain a data base for the North Pacific comparable to that available in the North Atlantic (Schmitz, 1984a; Schmitz et al., 1983) were planned in the late Long-term moored instrument observations spanning the Kuroshio Extension were first obtained in 1980-1982. Thirtyeight moored current-temperature meters were deployed for about two years along 152°E from 28° to 41°(Figure 1). Ten moorings were involved at a planned latitudinal spacing of 1.25 degrees in the center of the array and 2 degrees at the extremes. mooring had instruments at nominal depths of 500, 1200, and 4000 m, with four moorings also having instruments near 300 m depth as well as 200 m off the bottom. Data and results from the first setting of this array were discussed by Schmitz et al. (1982), and for the second setting and composite data set by Koblinsky et <u>al</u>. (1984), Niller et al. (1985), Schmitz (1984b,c), and Schmitz et al. (1987). Technical considerations have been described in some detail by Bradley (1982), and a data report is available (Levy and Tarbell, 1983).

In 1983, 14 additional moorings were deployed in the North Pacific (Figure 1, Table 1), in order to extend the exploration near the Kuroshio Extension across the Pacific. These measurements were also designed to expand the model-data intercomparisons of Schmitz and Holland (1982) [see also Schmitz et al. (1982) and Holland and Schmitz (1985)] to the North Pacific subtropical gyre, especially near the Kuroshio Extension. Each mooring had current-temperature meters at nominal depths of

150, 650, and 4000 m. This ZONAL exploration array was redeployed in 1984 and recovered for the final time in 1985.

Data from the first setting of these instruments have been used by Schmitz and Holland (1986). Results from the composite array (Schmitz, 1987, 1988) and a data report (Levy and Tarbell, 1987) are also available.

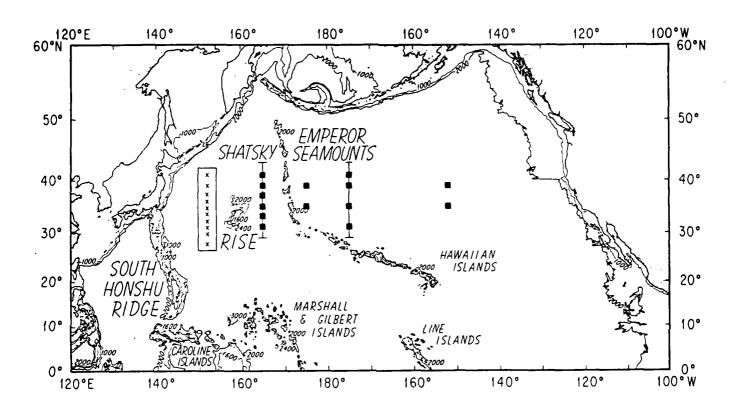


Fig. 1 Recent mooring locations in the North Pacific. The 152°E moorings (Schmitz et al., 1982) are denoted by X's, ZONAL exploration moorings (Table 1) by squares. Depth contours (in fathoms) and feature names taken from Chase et al. (1977).

North Pacific Mooring Locations - ZONAL Exploration
Fall 1983 — Fall 1985

Table 1

Longitude #2	Longitude #3	Longitude #4
(175°E)	(175°W)	(152°W)
	41°N	
39°N	39°N	39°N
2507	2504	2503
35°N	35°N	35°N
	31°N	
	Longitude #2 (175°E) 39°N 35°N	(175°E) (175°W) 41°N 39°N 35°N 35°N

II. TECHNICAL BACKGROUND

A. Moorings


The WHOI Buoy Group has been making in situ current velocity measurements in the ocean since 1960. The majority of these measurements are made from subsurface, intermediate moorings. The term "intermediate" refers to the fact that flotation, in the form of clusters of glass balls, is distributed along the mooring at intermediate depths as well as at the top. The balls are distributed in such a way that if a component fails, there is sufficient buoyancy remaining below the failed component to allow recovery of the remainder of the mooring without dragging. moorings for the ZONAL experiment except two were of this type (Fig. 2). The remaining two moorings were similar in design to the intermediates, but the upper flotation consisted of a syntactic foam sphere with 2,000 pounds of buoyancy. The sphere provides the same buoyancy as 40 glass balls with one-seventh the drag, thus improving the performance of the mooring in high currents. Since high currents were anticipated at two mooring sites in the western part of the array, sphere moorings were used at those sites. Figure 3 illustrates the sphere mooring.

Kerekering

25.55.55.25

CONTRACT BANKS

The WHOI Buoy Group moorings are constructed of off-the-shelf components. The upper 2000 meters of the mooring uses wire rope to minimize damage that could result from fish attack. The depth range and effects of fish bite on mooring lines have been documented by Berteaux and Prindle (1987). The wire rope used in the 20NAL moorings was 3/16 inch in diameter, jacketed with

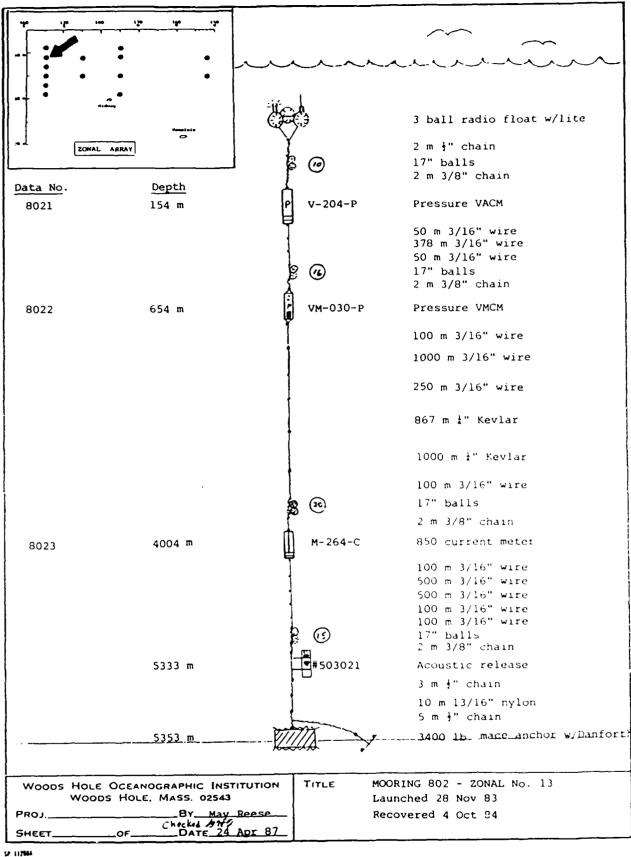

SP 11788A

Fig. 2 Typical WHOI Intermediate Mooring

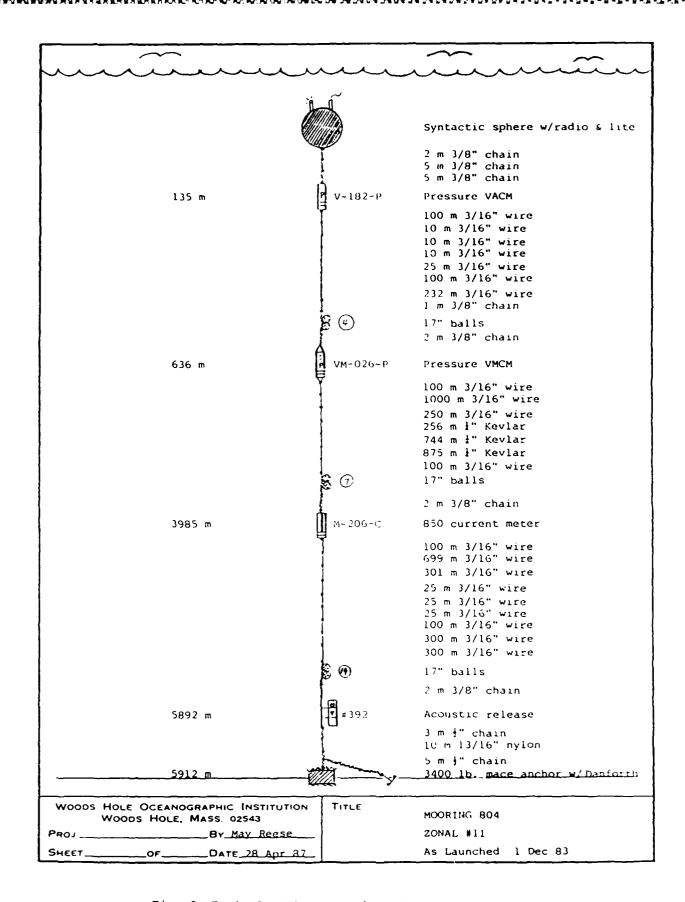


Fig. 3 Typical WHOI Syntactic Sphere Mooring

polyethylene, with a nominal breaking strength of 4000 pounds. Below a depth of 2,000 meters these moorings used 1/4 inch Kevlar, which has a nominal breaking strength of 6,000 pounds. Mooring components were connected with standard galvanized marine hardware, i.e. shackles, pear rings, eyebolts, etc. All mooring design, fabrication, launch, and recovery work was done by the WHOI Buoy Group. The ship used was the University of Washington's Research Vessel THOMAS G. THOMPSON.

A computer program entitled NOYFB (Moller, 1976) is used to design each mooring. This program mathematically constructs the mooring to the designer's specifications, subjects it to various current profiles, and predicts resultant performance. Two current profiles are usually tested. The first, or design current, represents the currents that the mooring will experience most of the time and must perform well in. The second is the worst case current profile that the mooring must be able to survive. Figures 4-6 show predicted performance of selected moorings from the array.

A total of fourteen moorings were deployed at mid-latitudes along four lines of longitude, 165°E, 175°E, 175°W and 152°W (Fig 7). All were launched for the first time in the fall of 1983. The two moorings along 152°W were of two years duration, and were recovered in the fall of 1985. The other twelve moorings were recovered after one year on station in October, 1984, re-deployed for another year, and recovered in the fall of 1985 during the same cruise the two-year moorings were recovered. Mooring drawings with nominal positions and launch and recovery

ZONAL MOORING NO. 2 PERFORMANCE

HORIZONTAL DISPLACEMENT (meters)

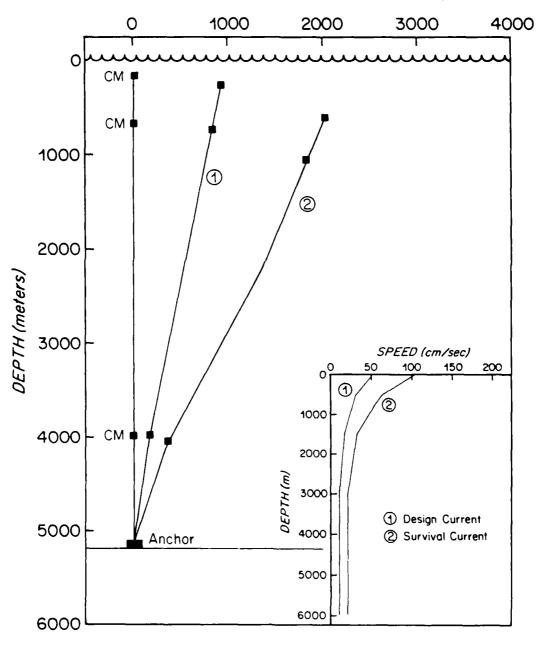


Fig. 4 Intermediate Mooring Performance - Eastern Current Profile

ZONAL MOORINGS 9 & 10 PERFORMANCE

HORIZONTAL DISPLACEMENT (meters)

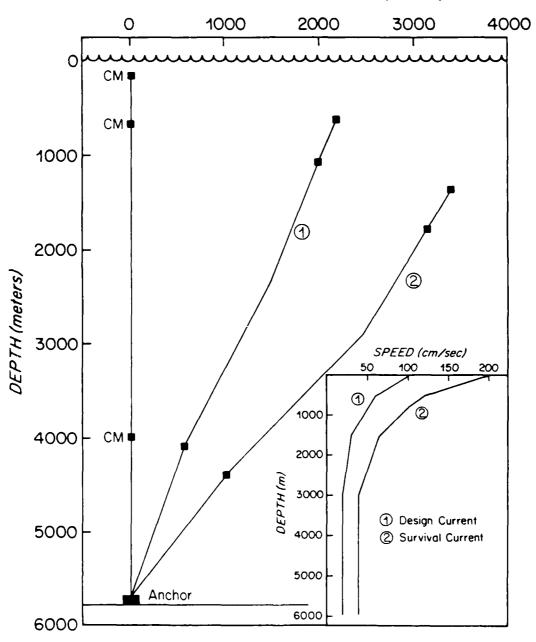


Fig. 5 Intermediate Mooring Performance - Western Current Profile

ZONAL MOORING NO. 11 PERFORMANCE

HORIZONTAL DISPLACEMENT (meters)

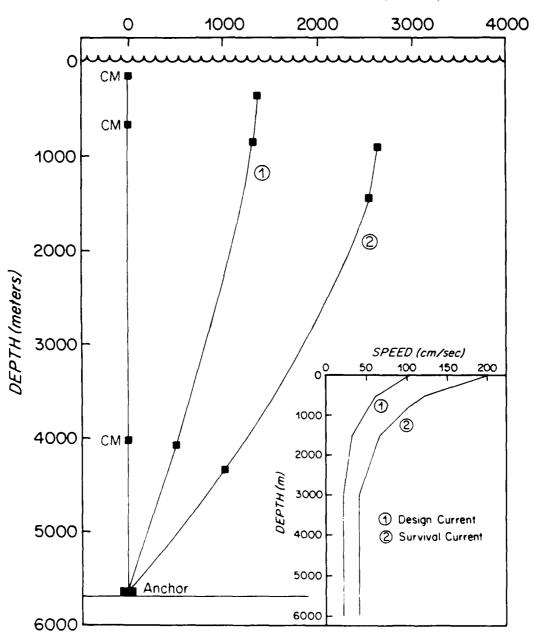


Fig. 6 Syntactic Sphere Mooring Performance - Western Current Profile

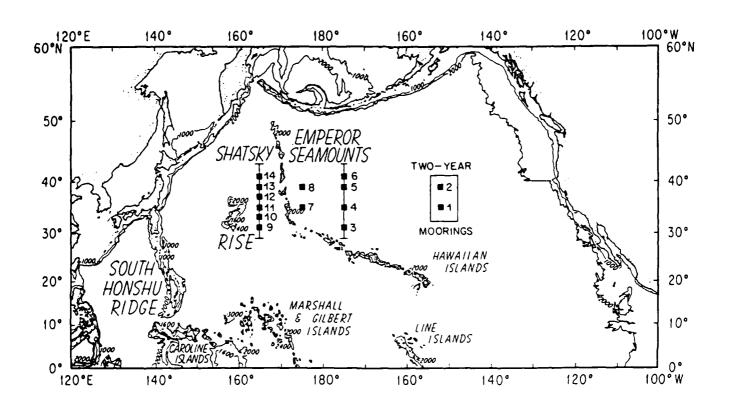


Fig. 7 ZONAL Mooring Array

dates appear in Section V.

The decision to use two-year moorings at the eastern part of the array was based on several factors. In the early planning stages the mooring cruises were to be in and out of either Honolulu or Midway Island. The location of these two moorings would have required several extra days of ship time to transit to the site in order to turn the moorings around at the one year point. By utilizing the two year mooring design which had been developed and was in the process of being tested, a considerable savings could be experienced. Test results in hand in early 1983 indicated a high probability of success for two-year deployments of subsurface moorings. This array was the first opportunity to use this new capability.

B. Instrumentation

Three types of current/temperature meters were used on the ZONAL moorings. They were Vector-Averaging Current Meters (VACM), Vector-Measuring Current Meters (VMCM), and Geodyne Model 850 Current meters (850). The VACM and VMCM are manufactured by E.G. & G. Sealink Systems. The 850 was built in the early '60s by Geodyne, a company which was later bought by E.G. & G. There were 19 VACMs, 7 VMCMs, and 16 850s on the first setting of the ZONAL array. The second setting consisted of 25 VACMs, 7 VMCMs, and 10 850s. The top current meter, at the 150 meter level on each of the ZONAL moorings, measured pressure in addition to current speed, direction, and temperature. pressure measurement shows to what degree the mooring leans in the current. It is also useful for determining the actual depth of the current measurements, especially if the launch site is in an area of rough bottom topography where actual depth of the mooring anchor is uncertain. Some moorings also had pressuremeasuring current meters at the 650 meter level.

Geodyne Model 850 Current Meter

The 850 current meter (Fig 8) measures current flow using a Savonius rotor and a direction-sensing vane, both mounted in a protective cage below the electronics and battery housing. The pressure housing, made of 7075-T6 aluminum, has an inside

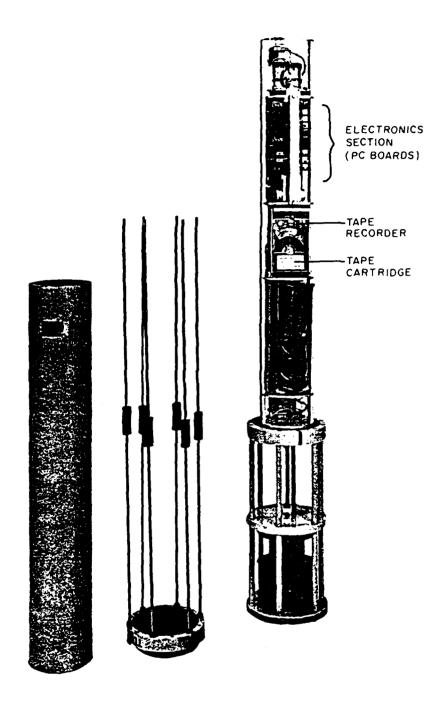


Fig. 8 Geodyne 850 Current Meter

diameter of 6 inches and a wall thickness of 1/2 inch, allowing deployments to a maximum pressure of 8,000 pounds per square inch (about 5300 meters). Maximum tensile load across the instrument is 5,000 pounds.

The Savonius rotor is an omnidirectional, cylindrical sensor which rotates about a vertical axis in response to the water flow. Sixteen magnets are equally spaced around the outer perimeter of the top plate of the rotor. As the rotor turns, a magnetic reed switch above it closes each time a magnet passes. The switch closures are counted for a specific time interval, 5.191 seconds, giving the rotation rate.

The vane senses the current direction with respect to the instrument housing. Two parallel magnets are fitted to the top of the vane, and spaced equidistant from the center of rotation.

Two parallel magnets with the same spacing from the center of rotation are enclosed in a fluid-damped vane follower inside the pressure case. They are magnetically coupled to the vane and free to rotate, "following" the vane. The vane follower's position is decoded by a 7-bit analog-to-digital converter, giving the direction of current flow with respect to the instrument housing.

The housing's orientation with respect to magnetic north is measured by an internal fluid-damped, gimballed compass mounted in the top of the instrument. The compass position is also decoded by a 7-bit analog-to digital converter. The sum of the compass and vane readings is the direction TO WHICH the current is flowing (as opposed to conventional wind measurements. In which the wind is measured FROM a particular direction).

Water temperature is measured by a thermistor, a device whose electrical resistance varies with changes in temperature. Mounted on the bottom end plate of the instrument housing, the thermistor senses the temperature of the end plate. The end plate does not change temperature instantaneously with the temperature of the water but has a time constant of about two minutes.

Timekeeping and the initiation of each data recording cycle are controlled by a solid-state quartz clock. The accuracy of the clock is plus or minus 1 second per day.

The 850 is a burst-sampling current meter, meaning that a short burst of data is recorded periodically. The length of the burst, and the number of bursts sampled per unit time determine how long the instrument will run. The battery, consisting of four strings of 8 alkaline "D" cells, supplies enough energy to record a full data tape regardless of the sampling scheme selected. For this experiment one burst was recorded each hour, on the hour. The burst length was 80 seconds. The data record, or burst, for this experiment was composed of 15 "strobes" of data, gathered at the rate of one strobe each 5,27 seconds (Fig. 9). Each strobe contains thirty-two bits of information, divided into two 16-bit fields, the first of which is "rotor", the second is "compass/vane". The first two bits of each 16-bit field are zeroes, which leaves 14 bits in each field for data. The first two strobes of each record are unique. The rotor field of the first strobe of each record contains a fourteen bit temperature word; the second strobe rotor field contains the 14 bit time

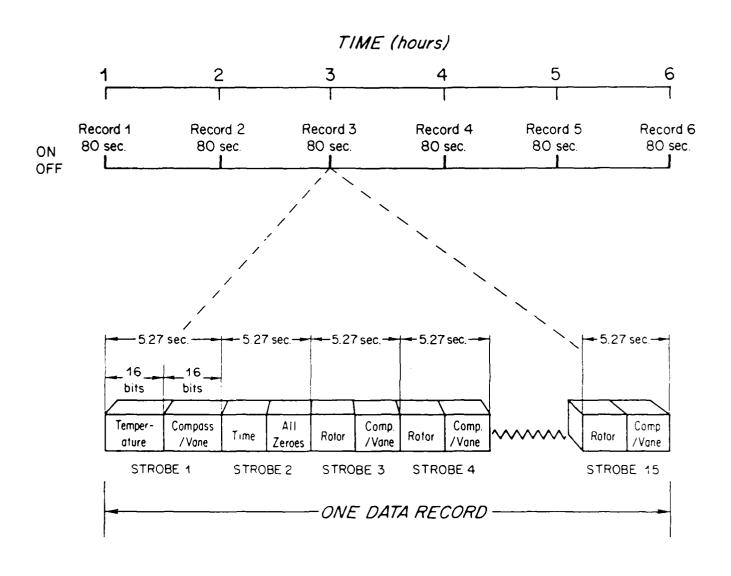


Fig. 9 Data Format, 850 Current Meter

word. The time word is a binary value whose least significant bit has a weight of 15 minutes, the most significant bit representing 85 days and eight hours. Before deployment, the clock is reset to all zeroes at a known time. This time is logged on the data sheet. The clock counts up from the all zeroes condition, incrementing by one count each fifteen minutes. The burst sampling rate has no effect on the time word, i.e. if the record rate is one hour, the clock word will advance by 4 each record, indicating that one hour, or four 15-minute bits, has elapsed since the last recording cycle. If the record rate is 15 minutes, the clock word will increment by one, indicating that 15 minutes has elapsed since the last data record. The time word on tape indicates the time at which the current meter began its 80 second data recording cycle. Later, during the data processing, the "time of observation" of each record is adjusted to fall in the center of the 80 second sample period. For strobes 3 through 15, the format reverts to rotor-compass-vane, each set (strobe) sampled once every 5, 27 seconds.

These data are recorded on an endless loop magnetic tape cartridge containing 400 feet of 1/4 inch wide tape. The tape in an endless loop cartridge moves in one direction only, feeding from the center of the spool and taking up on the outside perimeter. The recorder is fitted with a two-track head. The data tracks are written one at a time; that is, the entire 400 feet of tape is written on track "A" first. At the end of track "A", the passage of an end-of-tape marker, a piece of metallic foil about an inch long glued onto the tape, is sensed by the

tape recorder, switching the data recording from track "A" to track "B". Recording then continues on track "B" until the foil is sensed again, but this time the foil sensor shuts the current meter off.

In this experiment, as in most others, the data sampling is chosen such that at the planned time of recovery, the current meter will still be running. This is done partly to guard against automatic shutoff malfunctions, but primarily to be able to "mark" the data record after recovery with known events, usually rotor spins, occurring at a known time, providing a check on the clock. Also, ship scheduling can change, affecting recovery schedules.

Vector-Averaging Current Meter (VACM)

The VACM (Fig. 10), designed at WHOI, uses the same vane and Savonius rotor as the 850. The instrument housing and the rotor/vane protective cage assembly, however, are much stronger, allowing a 10,000 pound tensile load across the instrument, compared to 5,000 pounds for the 850. The pressure housing, made of 7075-T6 aluminum, has an inside diameter of 6 inches and a wall thickness of 3/4 inch, allowing deployment to a maximum pressure of 10,000 pounds per square inch (about 6,700 meters). Inside the pressure case, the VACM compass and vane follower are similar to those used in the 850. They are housed in aluminum cases, however, and contain no damping fluid. Damping is accomplished by the eddy currents of the moving magnets interacting with the aluminum housing. The analog to digital conversion of the compass and vane readings still utilizes a 7-

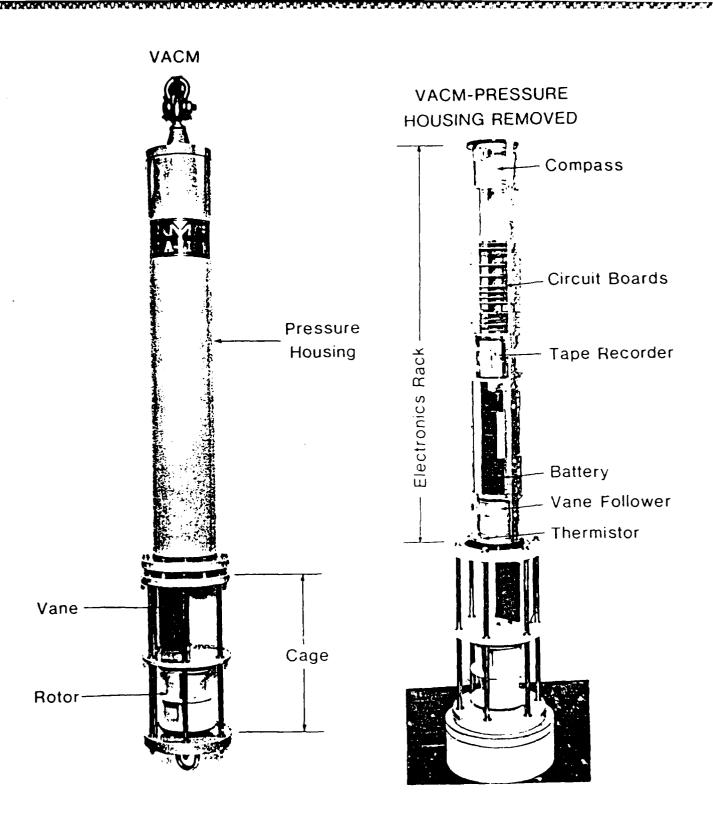


Fig. 10 Vector-Averaging Current Meter (VACM)

bit converter, but with solid-state components capable of very high interrogation rates. The compass or vane follower can be read at rates up to 100,000 times per second.

The rotor motion is sensed by a magneto-diode rather than a mechanical reed switch. The magneto-diode is a solid-state device whose resistance to electrical current flow changes when a magnetic field is close by. The 16 magnets on the top rim of the rotor are oriented with alternate north and south poles on the outside edge. Each time a north and south magnet passage is sensed, the current meter begins a computation cycle. In other words, each time the rotor rotates one-eighth of a turn, corresponding to the passage of 4.6 cm of water, the instrument goes through a cycle which reads the compass, reads the vane, and adds the two numbers to get a resultant flow direction for that 4.6 cm water parcel. The vector computer then converts the direction from polar coordinates to cartesian coordinates, resulting in a signed value of x and y, or east and north, for the direction of that parcel of water. These values are stored in the east and north memory registers, respectively, completing the data cycle. On the next 1/8 turn of the rotor, the cycle repeats, and the new values of east and north are added to those already in the storage registers. This summing process continues over a specific time interval, called the record interval - in the ZONAL experiment, 15 minutes (except for the two-year VACMs, which had a record rate of 1/2 hour). At the end of the record interval, the sums are written to tape, the East and North registers are reset to zero, and the process begins again.

example, if the current speed averaged one-half knot (25 cm/sec) during the fifteen minute record interval, the vector averaged current recorded for that interval would be the sum of 4,891 computation cycles.

Each tape record also contains a single instantaneous reading of the compass and vane follower. Since only the vector-averages are saved and the raw data is lost, sensor malfunctions would be more difficult to identify. For instance, if the compass were to stick (remain in one position), and the vane still functioned normally, it would be difficult to determine from the data which sensor was malfunctioning.

Actually, if the instrument were not near another one, it might be impossible to detect any malfunction at all. This is why one compass and vane follower value are written each record interval.

Like the 850, temperature is sensed by a thermistor mounted in the bottom end plate of the instrument. Unlike the 850, however, the thermistor is measured over the entire record interval rather than burst-sampled.

The record cycle is initiated by the clock circuit. Like the 850, the clock is quartz-controlled, with a maximum drift of plus or minus 1 second per day. It also has a register containing a time word which is part of the data record, identifying the time at which the record was written on tape. Since the data in a record has been accumulating for the fifteen minute period preceding the writing of that record on tape, the time of observation is adjusted backward during the data processing by 7.5 minutes to coincide with the mid-point of the vector-averaging period. Before deployment, the clock is reset

to the all-zeroes condition at a known time and counts up incrementally from there. The time word is sixteen bits long - the least significant bit representing a time increment of 7.5 minutes, each succeeding bit representing double the preceding value, with the most significant bit equalling 170 days, 16 hours.

The data is recorded on a standard digital 300 foot cassette in a four-track format. The standard record length is 32 characters of four bits each for a total of 128 bits. At a fifteen-minute record rate, the cassette will hold 500 days of data. East, North, Rotor, and Temperature each are 24 bits long. The Time (clock) field and Compass/Vane field are each 16 bits long. The order of the variables on tape is: East, North, Rotor, Compass/Vane, Time, Temperature. Extra variables on a non-standard data record, Pressure, for instance, are added to the end of the data stream. The data format for the pressure-recording VACMs on ZONAL is East, North, Rotor, Compass/Vane, Time, Temperature, and Pressure, for a total of thirty-eight data characters.

Power for the VACM is supplied by an alkaline battery pack containing 70 "D" cells connected to provide voltages of +21, -24, and +18 volts. Maximum deployment time using this battery is 18-20 months, regardless of the record rate selected.

The two-year VACM power supply is a lithium thionyl-chloride battery built by GTE. Lifetime of this battery is two and one-half years.

<u>Vector-Measuring Current Meter_(VMCM)</u>

The VMCM sensor is quite different than the 850/VACM. It uses two pairs of vertical propellers, oriented ninety degrees from each other (Fig 11). That is, if the axis of one propeller set were oriented East-West, the other axis would be oriented North-South. Developed at the Scripps Institution of Oceanography, (Weller and Davis, 1980) this instrument was designed to measure currents accurately in the presence of surface waves and vertical mooring motion. It is housed in a 7075-T6 aluminum tube with an inside diameter of 6 inches and a wall thickness of 3/4 inch, allowing deployment to a maximum pressure of 10,000 pounds per square inch - about 6,700 meters. The tube is clamped into a frame made of type 316 stainless steel which can accommodate tensile loads up to 10,000 pounds. propeller sets are designed with accurate co-sinusoidal response and correctly average fluctuating flow. There is no direction sensing vane, only an internal compass. Each propeller's rotation rate and direction of rotation are sampled four times per second by an internal microprocessor; the current direction and velocity are computed, converted to East and North components using the internal flux-gate compass as a reference, and summed into the East and North storage registers. At the end of the recording interval selected - fifteen minutes for the ZONAL experiment - the summed vector components and the total propeller values for each propeller set are written on tape. record, instantaneous compass value, and temperature are also

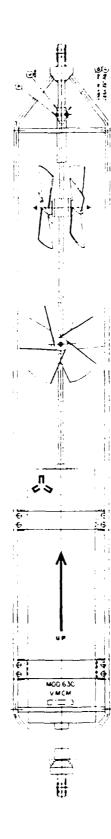


Fig. 11 Vector-Measuring Current Meter (VMCM)

recorded.

Timing information and control are provided by a quartz crystal controlled clock, like the other two current meter types. This clock, however, is different in that it increments by one per record regardless of the recording rate selected. Expressed another way, the least significant bit of the 16-bit time word represents the record interval; if the record rate is once per hour, the clock LSB increments once per hour...if the record rate is seven and one-half minutes, the time word increments by one each seven and one-half minutes, or 8 times per hour. The clock actually functions more as a record counter than as a clock.

Temperature, as in the other two instrument types, is measured by a thermistor mounted in the end cap of the current meter. The time constant of the end cap is approximately two minutes. The thermistor is sampled for a very short period of time, 33 milliseconds, at the beginning of each tape recording cycle.

Of the seven VMCMs used in the first year's ZONAL deployment, three were modified to record pressure. The second year's deployment also used seven VMCMs with five modified to record pressure.

The VMCM is unique among the three types of instruments used in ZONAL in that the data can be accessed by a portable computer or terminal using a connector in the top end cap, thereby allowing verification of proper operation immediately before launch or after recovery without having to open the pressure case.

Because the VMCMs were new to us and their reliability was not well known, they were deployed at the 650 meter level in the array, a level given a lower priority by the Principal Investigator.

III. CRUISES

The ZONAL array was deployed in the autumn of 1983, turned around (recovered and re-deployed) one year later, and recovered for the final time in the fall of 1985. The same ship was used for all three cruises, the R/V THOMAS G. THOMPSON, operated by the University of Washington in Seattle.

Each cruise consisted of two legs, with part or all of the science party being replaced between legs. The mid-cruise stop for the 1983 and 1984 cruises was Midway Island. In addition to science party changes, mooring anchors for the next leg of the cruise were loaded at Midway, as the ship could not hold all sixteen anchors (fourteen plus two spares) plus the rest of the mooring equipment and instrumentation. The mid-cruise stop for the 1985 cruise was Honolulu.

1983 Cruise - 17 Oct-10 Dec 83

The 1983 cruise had as a primary goal the deployment of an array of fourteen subsurface moorings with forty-two current meters for Dr. William J. Schmitz, Jr. A secondary goal was an XBT and CTD section along two lines of longitude, 175°W. and 165°E. from 29 to 43 degrees North for Dr. Terrence Joyce of WHOI. This data is not discussed in this report. A tertiary goal was the recovery of four subsurface moorings (Fig. 12-15) for Dr. Bruce Taft and Dr. Gunnar Roden of the University of Washington, plus CTD work near the moorings and an XBT survey of the Kuroshio Extension downstream of the southern pair of moorings.

Leg I.

The R/V THOMAS G. THOMPSON sailed from Seattle on cruise number 177 on October 17, 1983 at 0900 local time. The ship headed southwest toward the site of the first mooring to be launched, at 39°N., 152°W., arriving on 24 October. Enroute, the ship was slowed by heavy seas. The entire 1983 cruise was to be plagued with much rough weather, causing numerous injuries and making the deck work difficult.

ZONAL mooring no. 2 (Buoy Group Station No. 793), the Group's first mooring intended for a deployment duration of two years, was launched on 24 October. ZONAL no. 1, (B.G. Station No. 794), the second two-year mooring, was launched on October 25th.

The 20NAL mooring numbers, 1-14, were assigned to the moorings of the array during the design process as a means of identification. The Buoy Group Station numbers, on the other hand, are used as a data tracking tool and are assigned sequentially, as each mooring is launched. Mooring 793, for example, is the seven hundred ninety-third mooring the group has launched since its inception. Each current meter data tape is identified using the mooring number and a suffix indicating the instrument's relative vertical position on the mooring. For instance, the data number of the top current meter on mooring 793 would be 7931; the third current meter from the top on mooring number 823 would have a data number of 8233, and so on.

From mooring 794, the ship headed northwest towards 42° N., 175° W., the site of the first CTD station. CTD stations and positions appear in Table 2. After CTD Station No. 9, 2,000 meters of nearly new CTD wire had to be cut off due to an electrical short. This limited the maximum depth of CTD Station No's 10-26 to 5,300 meters. A new reel of CTD wire was airfreighted to Midway Island for use on leg II.

Moorings 795-798 were launched without incident as the ship proceeded south along the CTD section, although during the launch of mooring 796, the wind was gusting over sixty knots, and the Chief Scientist described the fantail as "very lively".

After the last CTD, at 28°N., 175°W., the ship headed southwest to Midway Island, arriving on 8 November, 1983.

Table 3 summarizes the leg I mooring work. Science personnel appear in Table 4.

Leg II.

Leg II of the '83 ZONAL cruise departed Midway Island at 1800 local time on November 10, 1983. The ship proceeded northwesterly to the first of six CTD stations planned near the Taft moorings A and B (Figs. 12 and 13). See also cruise track (Fig 17). CTD work and initial mooring work went well, but the second mooring, Mooring A, had serious problems.

The acoustic release fired normally and the mooring began to ascend. Before anything appeared on the surface, however, the ascent of the release stopped. Range to the release was minimized by moving the ship but three kilometers was the minimum range obtainable. The most logical conclusion seemed to be

Table 2

CTD Stations taken on Leg I of ZONAL Pacific Cruise, Fall 1^83

Station No.	DA MO YR	Start Time (GMT)	Stop Time (GMT)	North Latitude	West Longitude	Pressure Maximum (Decibars)
3	30 10 83	224	424	42 45.01	175 0.02	6275.0
4	30 10 83	1231	1410	42 0.07	175 0.06	6039.0
5	30 10 83	2148	2318	41 15.08	174 59.99	5989.0
6	31 10 83	1210	1335	40 30.00	174 59.99	5915.0
7	31 10 83	2025	2214	39 44.96	175 0.00	5997.0
8	1 11 83	533	708	39 0.00	175 0.00	5747.0
9	1 11 83	1948	2137	38 15.06	175 0.30	5797.0
10	2 11 83	1817	1930	37 29.98	175 0.10	4013.0
11	3 11 83	38	149	36 45.13	174 59.96	5071.0
12	3 11 83	941	1105	36 0.01	175 0.01	4983.0
13	3 11 83	1515	1636	35 39.98	175 0.02	4573.0
14	3 11 83	2103	2250	35 19.94	175 0.22	5315.0
15	4 11 83	414	547	35 0.00	175 0.30	5217.0
16	4 11 83	1500	1628	34 40.14	174 59.88	5265.0
17	4 11 83	2035	2222	34 20.00	174 59.87	5153.0
18	5 11 83	244	409	34 0.12	174 59.94	5169.0
19	5 11 83	954	1132	33 14.98	174 59.91	5479.0
20	5 11 83	2149	2228	32 29.96	175 0.06	1919.0
21	6 11 83	316	506	31 44.35	174 59.00	5275.0
22	6 11 83	1021	1139	30 59.92	175 0.06	5213.0
23	6 11 83	2235	30	30 15.00	175 0.00	5287.0
24	7 11 83	534	738	29 30.03	175 0.07	5271.0
25	7 11 83	1207	1332	28.45.00	174 59.99	5261.0
26	8 11 83	52	203	28 1.38	175 0.11	5115.0

Table 3

A Summary of the mooring work conducted during Leg I of the R/V Thomas G. Thompson Cruise Number 177

Moorings Deployed

<u>No</u> .	Date Launched	Position
793	24 Oct 83	38° 57.57'N 152° 01.82'W
794	25 Oct 83	35° 00.57'N 152° 00.67'W
795	31 Oct 83	41° 02.00'N 175° 00.97'W
796	1 Nov 83	38° 56.92'N 174° 55.09'W
797	4 Nov 83	35° 01.59'N 174° 58.29'W
798	6 Nov 83	31° 00.75'N 175° 03.10'W

Table 4

R/V Thomas G. Thompson, Cruise 177 Leg I Seattle, Washington - Midway Island, 17 Oct 83 - 8 Nov 83

1.	Alfred J. Ciesluk	Chief Scientist	WHOI
2.	William M. Ostrom	Mooring Supervisor	WHOI
3.	John N. Kemp	Mooring Technician	WHOI
4.	William H. Horn	Current Meter Technician	WHOI
5.	Brian F. Skelly	Current Meter Technician	WHOI
6.	Roderigue A. LaRochelle	Release Technician	NHOI
7.	Marvel C. Stalcup	CTD Technician	IOHW
8.	Robert C. Millard, Jr.	CTD Technician	WHOI
9.	Emile M. Bergeron	CTD Technician	WHOI
10.	Margaret M. Francis	CTD Technician	WHOI
11.	Thomas Leahman	Marine Technician U	niversity of Washington

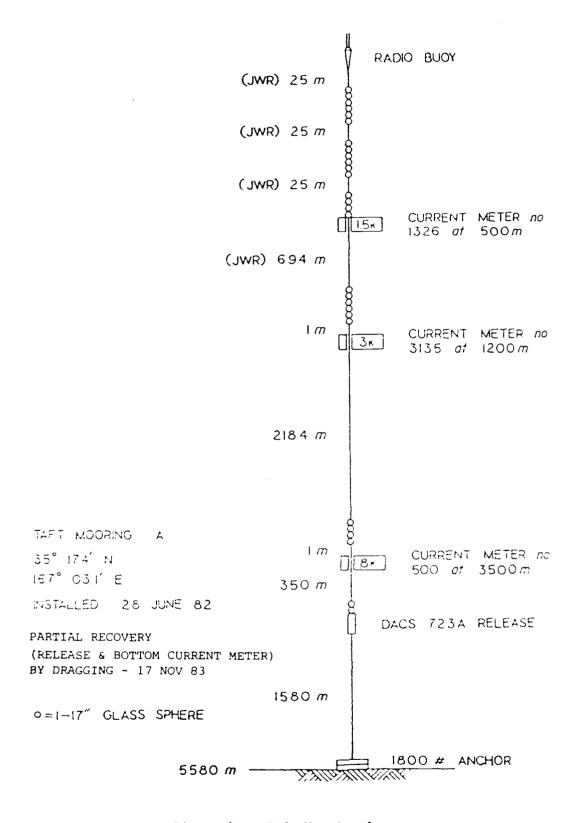


Figure 12 Taft Mooring A

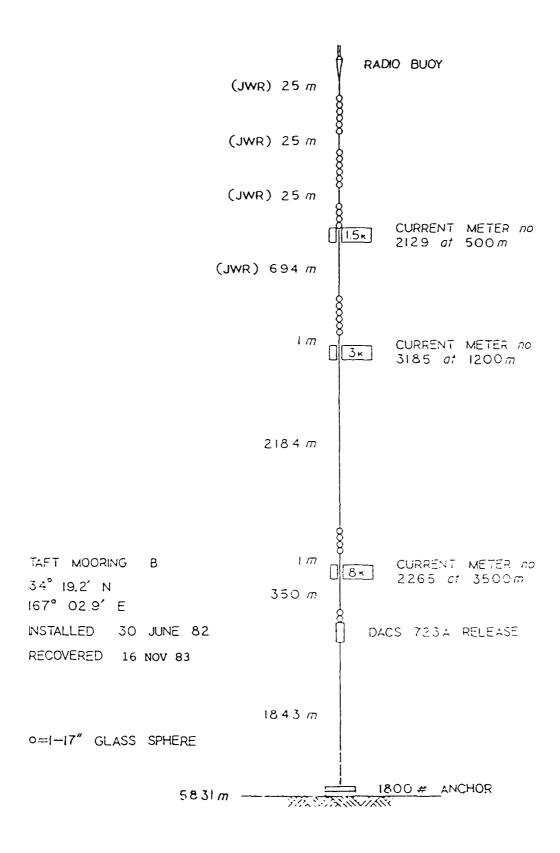


Figure 13 Taft Mooring B

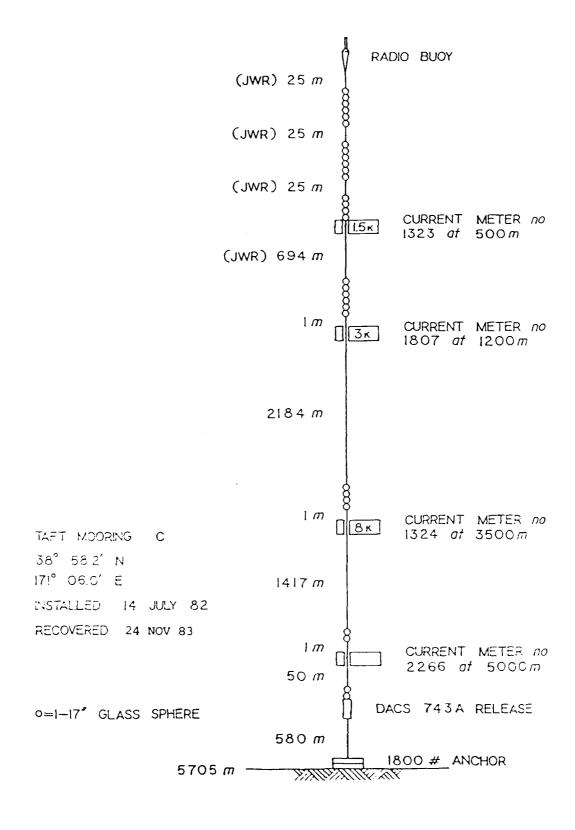


Figure 14 Taft Mooring C

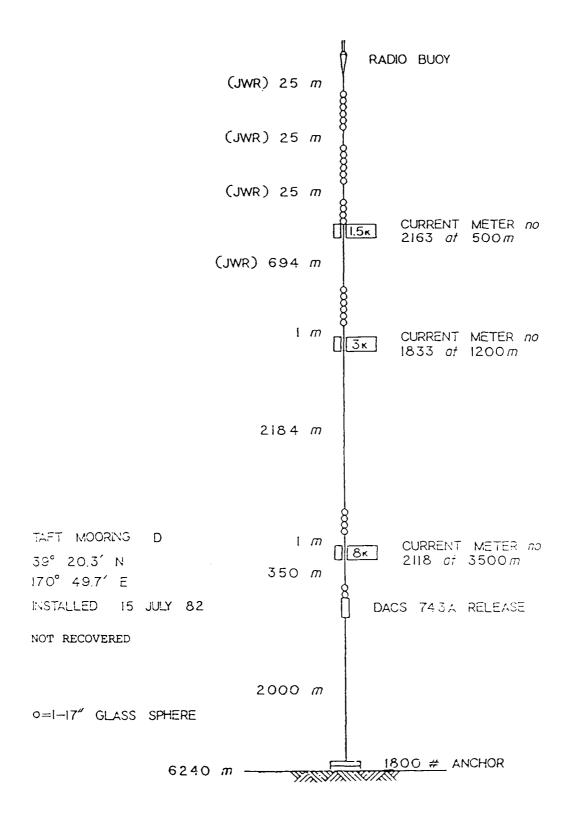


Figure 15 Taft Mooring D

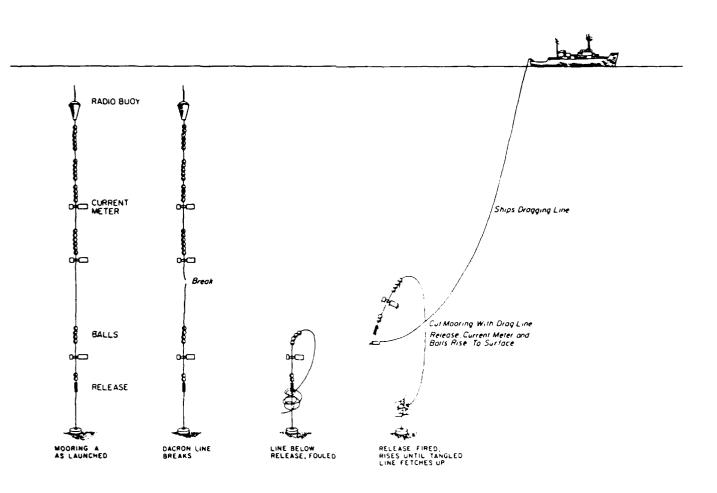


Fig. 16 Taft Mooring A failure and dragging procedure

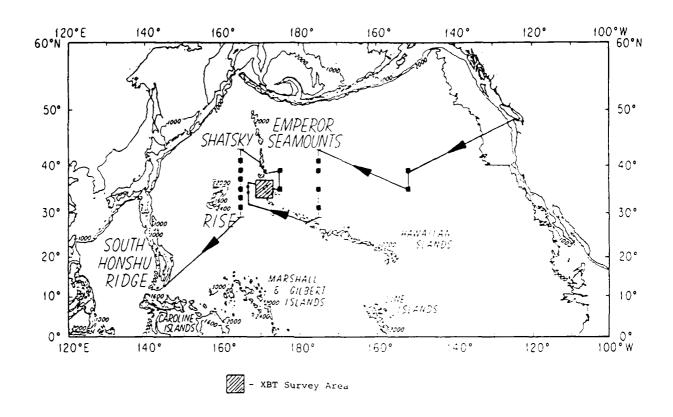


Fig. 17 Cruise Track, R/V THOMAS G. THOMPSON Cruise No. 177, 17 Oct 83 - 10 Dec 83.

that the mooring had parted somewhere in the 2,184 meter dacron section and the remainder of the dacron had fallen to the sea floor, tangling with the line below the release (Fig. 16). When the release fired, the glass balls remaining pulled it up until it fetched up on the tangle.

The decision was made to drag for the mooring using the trawl wire. The drag was successful, and proved the failure mode was as suspected - the line below the release was fouled with dacron from above the current meter. Recovered items were the release, one current meter, and six glass balls.

An XBT survey downstream of the two moorings was done next for Taft/Roden, followed by the launch of moorings 799 and 800. Mooring 799 was launched about 20 miles north of its intended position of 35°N., 175°E. because of a seamount discovered there during the pre-launch bottom survey.

Leaving mooring 800 and steaming west to the second pair of Taft moorings for CTDs and mooring recoveries, another mooring failure was encountered - seemingly identical to the earlier failure of mooring A. Again, when the release on mooring D was fired, the release started to ascend, then stopped. This time, however, worsening weather and approaching darkness precluded a dragging attempt. With the promise of another day of bad weather and cruise time running out, the decision was made to abandon the mooring. Disable commands were sent to the release, and we left the area, hoping to return in 1984 for a dragging attempt if the release was still responding.

The ship steamed northwest to 43°N., 165°E. to begin the

CTD/Mooring section (Tables 5 and 6). XBTs were taken every fifteen minutes of latitude from 43°N. to 30°N. The mooring work was routine with one exception. Mooring 805 was launched normally. The release was tracked to the bottom acoustically, and the normal post-launch testing was done. This testing consists of sending interrogate signals to the transponder to measure the range to the release, and testing the enable and disable functions. Tests are also done using different power levels to ascertain whether or not the receiver has weak spots, or "holes"; 1.e. certain power levels which it will not respond to. All tests done, the ship got underway and was leaving the area when the radio transmitter was heard, indicating that the radio float was on the surface. The mooring was recovered. During the recovery, repeated attempts were made to interrogate the release with negative results. When the release, or rather, the release tension rod, came aboard the mystery was solved. release had imploded and separated from the mounting clamps, taking one clamp with it. the tension rod was bent, and yellow paint near the bottom of it suggested the release had exited downward. One glass ball about two meters away from the release had also imploded. Sympathetic implosion is suspected, although which one went first will never be known.

At the time of failure the release was about 10 years old and had been deployed several times for periods of one year at depths greater than 5,000 meters. The depth of the release at this failure was 6,236 meters, about two percent deeper than its rated depth. Although the consensus on board was that the safety

Table 5 CTD Stations taken on Leg II of ZONAL Pacific Cruise, Fall 1983

Station No.	DA MO YR	Start Time (GMT)	Stop Time (GMT)	North Latitude	East Longitude	Pressure Maximum (Decibars)
1	14 11 83	1926	2056	33 0.00	167 0.00	6111.0
2	15 11 83	109	2 3 5	32 40.00	166 59.99	6153.0
3	15 11 83	838	1007	33 19.84	167 0.65	6211.0
4	15 11 83	1421	1544	33 39.83	167 0.10	6103.0
5	15 11 83	1943	2105	34 0.03	167 0.07	6125.0
6	16 11 83	401	522	34 20.00	167 0.10	5847.0
7	20 11 83	953	1117	35 21.70	174 59.80	5077.0
8	21 11 83	2020	2137	39 1.40	175 0.20	5001.0
9	24 11 83	521	700	39 21.41	170 44.84	6363.0
10	25 11 83	2102	2222	43 0.15	165 0.03	5505.0
11	26 11 83	438	600	42 14.27	164 58.48	5083.0
12	26 11 83	1059	1220	41 44.90	164 59.70	4899.0
13	26 11 83	1709	1818	41 15.00	165 0.20	5105.0
14	27 11 83	601	716	40 45.10	165 0.10	5519.0
15	27 11 83	1142	1319	40 14.83	164 57.91	5557.0
16	27 11 83	1936	2057	39 29.80	164 59.90	5275.0
17	28 11 83	939	1119	38 44.37	164 59.71	5399.0
18	28 11 83	1726	1845	37 59.80	164 59.80	5535.0
19	29 11 83	1012	1137	37 17.10	165 0.00	3869.0
20	30 11 83	1306	1508	36 0.69	164 59.64	5591.0
21	1 12 83	503	650	35 5.60	165 0.90	6053.0
22	1 12 83	1432	1639	34 28.35	165 2.04	6037.0
23	2 12 83	32	219	33 59.90	165 0.10	6207.0
24	2 12 83	831	1027	33 29.90	164 59.80	6259.0
25	3 12 83	417	617	32 44.95	165 0.00	6375.0
26	3 12 83	2205	2359	31 59.90	165 0.00	6123.0
27	4 12 83	848	1044	30 58.70	164 58.80	6183.0
28	4 12 83	2042	2224	30 30.00	164 59.30	6039.0

Table 6

A Summary of the Mooring Work conducted during Leg II of R/V Thomas G. Thompson Cruise Number 177

Moorings Deployed

<u>No</u> .	Date	Laur	nched		Position	<u>1</u>	
799	20	Nov	83	35°	15.95'N	175°	00.41'W
800	22	Nov	83	39°	00.15'N	175°	00.03'E
801	27	Nov	83	41°	06.94'N	165°	02.60'E
802	28	Nov	83	38°	58.9'N	164°	58.0'E
803	30	Nov	83	37°	01.71'N	165°	01.03'E
804	1	Dec	83	35°	00.6'N	165°	02.39'W
* 805	2	Dec	83	32°	59.35'N	164°	59.51'E
806	3	Dec	83	33°	00.8'N	165°	00.03'E
807	4	Dec	83	30°	59.8'N	165°	00.0'E

^{*}Mooring 805 failed due to acoustic release implosion, was recovered 2 Dec 83, and re-launched as Mooring 806 with a new release.

Moorings Recovered

No.	Date Launched	Date Recovered	Position		
В	30 Jun 82	16 Nov 83	34° 19.2'N	167° 02.9'E	
* A	28 Jun 82	17 Nov 83	35° 17.4'N	167° 03.1 E	
С	14 Jul 82	24 Nov 83	38° 58.2'N	171° 06.0'E	

Mooring A was partially recovered (the acoustic release and one current meter) by dragging.

Table 7

R/V Thomas G. Thompson, Cruise Number 177 Leg II

Midway Island - Guam, 10 Nov 83 - 10 Dec 83

1.	George H. Tupper	Chief Scientist	WHOI
2.	R. David Simoneau	Mooring Supervisor	WHOI
3.	John B. Reese	Mooring Technician	WHOI
4.	Joseph R. Poirier	Current Meter Technician	WHOI
5.	Craig D. Marquette	Current Meter Technician	WHOI
6.	Scott E. Worrilow	Release Technician	WHOI
7.	Marguerite E. Zemanovic	Data Processor	WHOI
8.	Terrence M. Joyce	Associate Scientist	WHOI
9.	Ronald Kroll	CTD Technician	WHOI
10.	Thomas Crook	CTD Technician	WHOI
11.	Cynthia H. Lanyon	CTD Technician	WHOI
12.	Edward Seifert	Current Meter Technician	Oregon State University
13.	Dennis Root	Current Meter Technician	Oregon State University
14.	John Konecki	Marine Technician	University of Washington

factor used when rating these units was probably greater than 2 percent, when the mooring was re-launched, the replacement release was moved up to just within its rated depth capability.

The weather was poor throughout the cruise, with winds averaging 30-35 knots and seas of 10-20 feet. The mooring work went well in spite of this and no instruments were banged on the rail or the deck during launch. After launch of the last mooring, one more CTD was done at 30°30'N after which the ship headed for Guam, arriving on the morning of 10 December 1983.

Personnel on the cruise are shown in Table 7.

1984 Cruise - 19 Sep-3 Nov 84

The goal of the 1984 ZONAL cruise was to recover and redeploy 12 subsurface moorings launched the previous year. A secondary goal was the occupation for a second year of two CTD sections, one along 165°E., the other along 175°W., both sections extending from 28°N. to 44°N., for Dr. Terrence Joyce. The cruise would be staged out of Honolulu, with a stop in Midway Island to change personnel and load the remaining anchors. The cruise track is shown in Figure 18.

Leg I.

The first leg of R/V THOMAS G. THOMPSON cruise no. 184 departed Honolulu on the 19th of September, 1984, one day later than planned. The reason for the late departure was the discovery enroute to Honolulu of a crack in the hull below the waterline on the starboard bow. Repairs to the hull took an

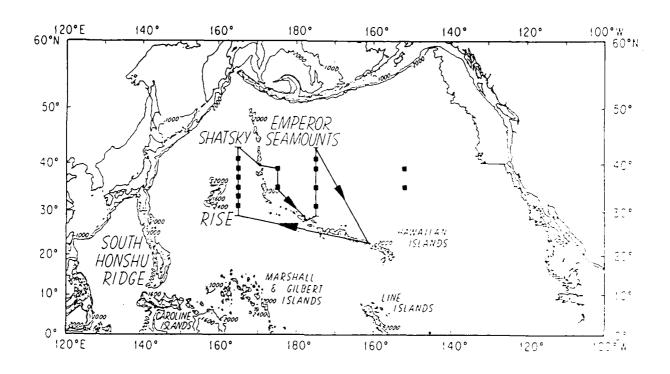


Fig. 18 Cruise Track, R/V THOMAS G. THOMPSON Cruise No. 184, 19 Sept 84 - 3 Nov 84.

Table 8

CTD Stations taken on Leg I of
ZONAL Pacific Cruise, Fall 1984

Station No.	DA MO YR	Start Time (GMT)	Stop Time (GMT)	North Latitude	East Longitude	Pressure Maximum (Decibars)
1	23 9 84	1205	1238	24 40.10	175 0.40*	1999.0
2	25 9 84	1127	1236	26 50.17	174 59.64	5703.0
3	27 9 84	1050	1203	28 59.99	164 59.61	5969.0
4	27 9 84	1827	1937	30 0.27	165 0.14	5919.0
5	28 9 84	846	1011	30 45.29	164 59.58	5845.0
6	28 9 84	1905	2030	30 59.78	165 0.16	6155.0
7	29 9 84	640	804	31 30.60	165 1.10	6037.0
8	29 9 84	1351	1519	32 15.10	165 0.00	6261.0
9	30 9 84	702	829	33 0.01	165 0.03	6375.0
10	30 9 84	1931	2058	33 30.03	164 59.96	6293.0
11	1 10 84	115	246	33 59.97	165 0.00	6245.0
12	1 10 84	701	857	34 33.25	165 3.06	6071.0
13	1 10 84	2007	2208	35 0.05	165 0.00	5997.0
14	2 10 84	1507	1644	35 30.07	164 59.96	5995.0
15	2 10 84	2221	2352	36 0.06	165 0.02	5617.0
16	3 10 84	443	606	36 30.00	164 59.97	5651.0
17	3 10 84	1751	1857	37 1.80	165 1.19	4623.0
18	4 10 84	531	649	37 45.13	164 59.84	5449.0
19	4 10 84	1239	1346	38 29.96	164 59.78	4845.0
20	5 10 84	42	158	39 0.02	164 59.99	5433.0
21	5 10 84	947	1111	39 15.00	165 0.17	5379.0
22	5 10 84	1544	1700	39 45.12	165 0.22	\$535.0
23	5 10 84	2124	2250	40 15.17	165 0.19	5557.0
24	6 10 84	308	424	40 46.30	164 58.78	5485.0
25	7 10 84	626	740	41 14.55	165 3.15	5193.0
26	7 10 84	1220	1330	41 44.96 42 15.09	164 59.98 164 59.96	4889.0 4761.0
27 28	7 10 84 8 10 84	1801 53	1801 206	43 0.06	165 0.00	5509.0
29	8 10 84	914	1039	44 0.14	164 59.98	5837.0
30	12 10 84	1328	1442	39 0.11	175 0.07	5009.0
31	13 10 84	2317	31	35 16.00	175 0.03	5027.0
	40 04		J.	10 10100		-

West Longitude, Sta. 1 only

extra day.

A course was set for 29°N., 165°E., the position of the first CTD station (Table 8). Along the way, two test stations were taken to verify proper CTD operation.

Mooring work for this leg was the recovery of moorings 799-804, and 806-807. Replacement moorings for the second year's deployment were numbered 815-819 and 821-823 (Table 9). As on the 1983 cruise, mooring work was routine except for one mooring, number 820. During the final checks on the release after it was on the bottom, the release malfunctioned and fired, releasing the anchor. The mooring was recovered and re-deployed with a fresh release as mooring 821. Mooring 820's release problem was found to be electrical arcing between two adjacent circuit connector pins each time the pinger pinged, causing a false fire signal. This problem did not show up on the release lowering test. Before deployment, each release is tested to 2,000 meters on the CTD wire as a final check on its operation in the water, at temperature and pressure. Later testing showed the transducer was a little loose inside the rubber boot, raising the possibility that if the transducer shifted somehow at the greater pressure below 5,000 meters, it could have overloaded the pinger drive circuitry, causing the arcing that sent the false fire signal.

After finishing the 165°E. work, the ship headed for the site of the failed Taft mooring D which had been abandoned the previous year. On arrival, nothing could be heard from the release. Without acoustic contact, it was felt that a dragging

Table 9

A Summary of the Mooring Work conducted during Leg I of R/V Thomas G. Thompson Cruise Number 184

		Moorings Recovered	
<u>No</u> .	Date Launched	Date Recovered	Position
807	4 Dec 83	28 Sep 84	30° 59.8'N 165° 00.00'E
806	3 Dec 83	30 Sep 84	33° 00.8'N 165° 00.03'E
804	1 Dec 83	1 Oct 84	35° 00.6'N 165° 02.39'E
803	30 Nov 83	3 Oct 84	37° 01.71'N 165° 01.03'E
802	28 Nov 83	4 Oct 84	38° 58.9'N 164° 58.0'E
801	27 Nov 83	6 Oct 84	41° 06.94'N 165° 02.6'E
800	22 Nov 83	12 Oct 84	39° 00.15'N 175° 00.03'E
799	20 Nov 83	13 Oct 84	35° 15.95'N 175° 00.41'E
		Moorings Deployed	
No	Data Launahad		Donlaged Measure No.
$\frac{No}{}$.	Date Launched	Position	Replaced Mooring No.
815	29 Sep 84	31° 02.13'N 164°	55.05 E 807
816	30 Sep 84	33° 00.3'N 164°	58.9'E 806
817	2 Oct 84	34° 59.66'N 164°	59.65'E 804
818	4 Oct 84	37° 02.59'N 165°	02.4'E 803
819	5 Oct 84	38° 59.48'N 164°	59.42'E 802
* 820	6 Oct 84	41° 06.64'N 165°	03.52'E 801
821	6 Oct 84	41° 04.86'N 165°	02.85'E 820
822	12 Oct 84	38° 59.61'N 175°	00.74'E 800
823	14 Oct 84	35° 16.51'N 174°	56.95'E 799

Mooring 820 failed due to acoustic release malfunction, was recovered 6 Oct 84, and re-launched as Mooring 821 with a new release.

Table 10

R/V Thomas G. Thompson, Cruise Number 184 Leg I

Honolulu - Midway Island, 19 Sep 84 - 16 Oct 84

1.	George H. Tupper	Chief Scientist	WHOI
2.	R. David Simoneau	Mooring Supervisor	WHOI
3.	Scott Worrilow	Release Technician	WHOI
4.	John B. Reese	Mooring Technician	WHOI
5	Carol A. Mills	Data Processor	WHOI
6.	Cynthia H. Lanyon	CTD Technician	WHOI
7.	Roderigue A. LaRochelle	Release Technician	WHOI
8.	Kelly G. Luetkemeyer	Mooring Technician	WHOI
9.	Kevin Lange	Mooring Technician	MHOI
10.	Robert E. McDevitt	CTD Technician	MHOI
11.	Marvel C. Stalcup	CTD Technician	NHOI
12.	Douglas Kaye	Guest Investigator	Burlington Battery Corp.
13.	Thomas Leahman	Marine Technician	University of Washington

operation would be futile because of the poor navigation available.

The rest of the mooring work went well. The moorings had been designed with wire and Kevlar re-usability in mind; 74% of the wire was re-used, 77% of the Kevlar was. The last mooring to be launched was number 823. From there, the ship steamed southeast for Midway Island, arriving on October 16, 1984.

Leg I Cruise personnel are shown in Table 10.

Leg II.

The second leg of the 1984 ZONAL cruise departed Midway Island on the 19th of October at 1400 local time enroute to position 28°N., 175°W., where the first CTD station (number 32 of the cruise) was taken. From there the cruise proceeded north along 175°W. taking XBTs every 15 minutes of latitude and CTDs at positions designated by Dr. Terrence Joyce (WHOI) prior to the cruise. Throughout the second leg of the cruise a total of 24 CTD stations were made. Table 11 summarizes them.

The mooring work conducted consisted of turning around four subsurface current meter moorings as they were encountered during the trip northward. Four moorings that had been deployed in 1983 were to be recovered and re-deployed with fresh instrumentation for an additional year, thereby occupying each mooring site for two years. Following the recovery of each mooring a replacement mooring with the same instrument placement (but not necessarily the same current meter type) was deployed (Table 12).

All of the mooring operations were routine with the

Table || CTD Stations taken on Leg II of ZONAL Pacific Cruise, Fall 1984

Station No.	DA MO YR	Start Time (GMT)	Stop Time (GMT)	North Latitude	West Longi tude	Pressure Maximum (Decibars)
32	19 10 84	1338	1534	28 0.22	174 59.44	5241.0
33	19 10 84	2339	100	29 0.02	175 0.15	5437.0
34	20 10 84	841	1008	29 59.98	175 0.05	5419.0
35	20 10 84	1553	1712	30 39.91	175 0.05	5461.0
36	21 10 84	1359	1525	31 19.98	175 0.01	5703.0
37	21 10 84	2120	2245	32 0.01	175 0.03	5777.0
38	22 10 84	426	523	32 40.00	174 59.99	3765.0
39	22 10 84	1032	1200	33 20.01	175 0.37	5601.0
40	22 10 84	1739	1904	33 59.97	175 0.03	5677.0
41	23 10 84	255	1613	34 40.18	174 59.98	5531.0
42	24 10 84	132	255	35 20.28	174 59.30	5275.0
43	24 10 84	823	941	36 0.16	175 0.20	5011.0
44	24 10 84	1456	1625	36 40.03	174 59.99	5857.0
45	24 10 84	2150	2302	37 19.82	175 0.16	4687.0
46	26 10 84	411	526	38 0.06	174 59.92	4691.0
47	25 10 84	1107	1238	38 40.08	175 0.00	5779.0
48	26 10 84	706	837	39 20.00	174 59.94	5587.0
49	26 10 84	1356	1531	39 59.91	175 0.01	6003.0
50	26 10 84	2120	2248	40 40.01	175 0.10	5953.0
51	27 10 84	1510	1636	41 19.88	174 59.86	5963.0
52	27 10 84	2212	2319	42 0.00	175 0.04	5919.0
53	28 10 84	512	644	42 39.96	175 0.21	6129.0
54	28 10 84	1156	1334	43 19.78	175 0.22	6513.0
55	28 10 84	1858	2030	44 0.00	175 0.21	5813.0

Table 12

A Summary of the Mooring Work conducted during Leg II of R/V Thomas G. Thompson Cruise Number 184

Moorings Recovered

No.	Date Launcheo	Date Recovered	Position
798	6 Nov 83	21 Oct 84	31° 00.75'N 175° 03.10'W
797	4 Nov 83	23 Oct 84	35° 01.59'N 174° 58.29'W
796	1 Nov 83	25 Oct 84	38° 56.92'N 174° 55.09'W
795	31 Oct 83	27 Oct 84	41° 02.00'N 175° 00.97'W

Moorings Deployed

No.	Date Launched	Position	Replaced Mooring No.
824	21 Oct 84	31° 01.14'N 175° 03.72'W	798
825	23 Oct 84	35° 03.17'N 174° 57.99'W	797
826	26 Oct 84	38° 56.83'N 174° 56.08'W	796
827	27 Oct 84	41° 01.40'N 175° 01.26'W	795

Table 13

R/V Thomas G. Thompson, Cruise Number 184 Leg II

Midway Island - Honolulu, 19 Oct 84 - 3 Nov 84

1.	Richard P. Trask	Chief Scientist	WHOI
2.	William M. Ostrom	Mooring Supervisor	WHOI
3.	Matthew R. Gould	Mooring Technician	WHOI
4.	William Sadler	Mooring Technician	WHOI
5.	Scott E. Worrilow	Release Technician	WHOI
6.	William H. Horn	Current Meter Technician	WHOI
7.	Ellen Levy	Data Processor	WHOI
8.	Ronald Kroll	CTD Technician	WHOI
9.	Margaret M. Francis	CTD Technician	WHOI
10.	Jane A. Dunworth	CTD Technician	WHOI
11.	William G. Metcalf	Guest Investigator	WHOI
12.	John Konecki	Marine Technician	University of Washington

TO DESCRIPTION OF PROCESSION OF PROCESSION OF PROPERTY OF PROPERTY

exception of mooring 797. During the recovery of the third cluster of glass balls it was necessary to make use of several crosby clips in order to transfer the active part of the mooring to the rehaul winch. When the transfer was made, the crosby clips could not hold the tension, allowing the remaining part of the mooring (1567 meters of wire rope, the fourth cluster of glass balls, and an acoustic release) to go adrift. Meanwhile, the third cluster of balls still had to be brought aboard before the ship could go off searching for the lower part of the mooring. While recovering the third cluster of glass balls, a similar failure occurred (slipping crosby clips). As a result, the glass ball cluster dropped back into the water. The ship's crew then had to re-maneuver the ship so that the glass balls could be recovered. Once that cluster was on board, the cluster of balls and release that were adrift were re-located by navigating on the acoustic release. Course changes were made to minimize acoustic ranges until visual contact could be made. night recovery made it necessary for the ship to get relatively close (.15 km) to the glass ball cluster before it could be spotted.

Service of the servic

Throughout the mooring work every attempt was made to save as much of the recovered mooring wire and Kevlar as possible for re-use on the replacement moorings. As a result of the mooring design and care taken during recovery, 62% of the wire and 88% of the Kevlar were re-used during the leg II operations.

Following the last mooring operation, the cruise continued to the north taking CTD stations. The final CTD station of the

cruise (number 55) was taken at 44°N., 175°W. From there the ship steamed southeast toward Hawaii, arriving in Honolulu on the 3rd of November, 1984.

Personnel on leg II appear in Table 13.

<u> 1985 Cruise - 24 Sep-2 Nov 85</u>

The goal of the third ZONAL cruise was the successful recovery of 14 subsurface moorings with 42 current meters for Dr. William J. Schmitz, Jr. A secondary goal was the recovery of two moorings along 152°W., requested by Dr. Peter Niller, Scripps Institution of Oceanography.

Leg I.

Leg I of the 1985 ZONAL cruise sailed from Seattle on 24
September, 1985. As the 1983 cruise had more than its share of bad weather, this cruise was to have almost no bad weather.

Arriving at the site of the first mooring to be recovered,
Niller's mooring number 193, the release fired the first time,
the mooring was recovered, and we were on our way in about 3
hours. On September 30, the ship arrived at the site of the first two-year mooring, mooring number 793. This mooring, like
794, the other two-year mooring, had tandem acoustic releases mounted side-by-side such that proper actuation of either of them would release the mooring from the anchor. One of the releases

A Summary of the Mooring Work conducted during Leg I of R/V Thomas G. Thompson Cruise Number 191

Table 14

Moorings Recovered

<u>No</u> .	Date Launched	Date Recovered	Position
* 193	May, 1984	29 Sep 85	42°N 152°W
793	24 Oct 83	30 Sep 85	38° 57.57'N _52° 01.82'W
794	25 Oct 83	1 Oct 85	35° 00.57'N 152° 00.67'W
* 192	May 1984	3 Oct 85	28°N 152°W

Moorings 192 and 193 were not part of the ZONAL experiment, but belonged to Dr. Peter Niiler of the Scripps Institution of Oceanography, and were recovered at his request.

Table 15

R/V Thomas G. Thompson, Cruise Number 191 Leg I

Seattle - Honolulu, 24 Sep 85 - 5 Oct 85

SECOND CONTRACTOR DESCRIPTION OF THE PROPERTY OF THE PROPERTY

proper Verereren Sassasser) Franklike en sassasser

1.	George H. Tupper	Chief Scientist	MHOI
2.	William M. Ostrom	Mooring Supervisor	WHOI
3.	Steven P. Longworth	Mooring Technician	WHOI
4.	Bryan S. Way	Current Meter Technician	WHOI
5.	Craig D. Marquette	Current Meter Technician	MHOI
6.	Ellen Levy	Data Processor	WHOI
7.	Samuel Hocker	Mooring Technician	University of Miami
8.	Thomas Leahman	Marine Technician	University of Washington

had a lithium receiver battery, the other an alkaline battery and an electronic cycling clock which let the receiver listen one hour out of four, saving 75% of the power necessary for the receiver. Both releases on mooring 793 answered the first time. The clock release was arbitrarily chosen to release this mooring. It fired the first time. Because it was the middle of the night, the ship was navigated acoustically very close to the mooring before release. As a result, the radio float surfaced within 200 yards of the ship.

During recovery of this mooring, the releases caught under the counter of the fantail, ripping the protective transducer cage off the lithium release. Later on in the cruise, this release fired in the lab when a door slammed. This is discussed further in section IV.

Mooring 794, the other two-year mooring, had to be fired using the clock release because the lithium release would not fire. It received all commands and responded to them, but would not accept the fire command. After recovery, the firing battery was found completely discharged, the result of a leaky squib.

The remaining mooring to be recovered, Niller's mooring number 192, was recovered without difficulty and the ship headed southwest to Honolulu, arriving on the fifth of October, 1985.

A summary of Leg I mooring operations appears in Table 14.

Cruise personnel are shown in Table 15.

Leg II.

The purpose of this leg was to recover the remaining eight

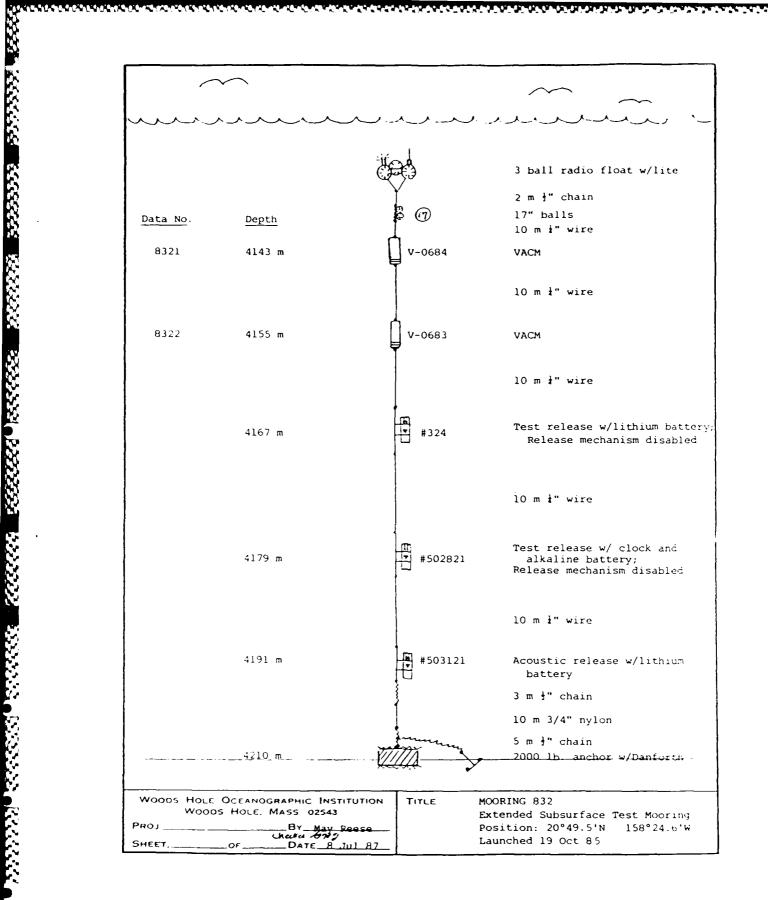


Fig. 19 Extended Duration Subsurface Mooring

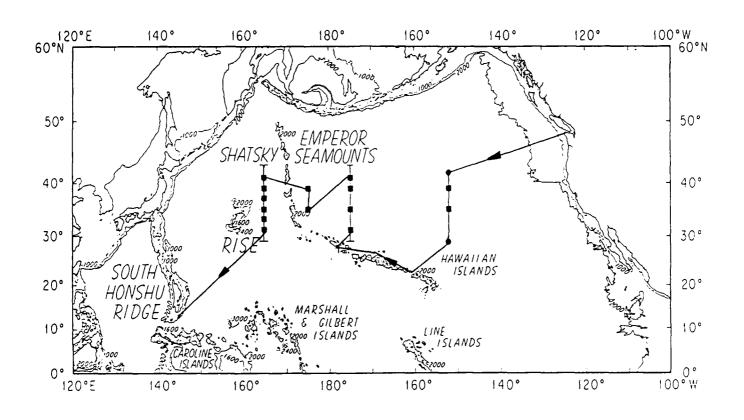


Fig. 20 Cruise Track, R/V THOMAS G. THOMPSON Cruise No. 191, 24 Sep 35 - 2 Nov 85.

Table 16

A Summary of the Mooring Work conducted during Leg II of R/V Thomas G. Thompson Cruise Number 191

Moorings Recovered

No.	Date Launched	Date Recovered	Position
824	21 Oct 84	17 Oct 85	31° 01.14'N 175° 03.72'W
825	23 Oct 84	18 Oct 85	35° 03.17'N 174° 57.99'W
826	26 Oct 84	19 Oct 85	38° 56.83'N 174° 56.08'W
827	27 Oct 84	20 Oct 85	41° 01.40'N 175° 01.26'W
823	14 Oct 84	22 Oct 85	35° 16.51'N 174° 56.95'E
822	12 Oct 84	23 Oct 85	38° 59.61'N 175° 00.74'E
821	7 Oct 84	25 Oct 85	41° 04.86'N 165° 02.85'E
819	5 Oct 84	25 Oct 85	38°59.48'N 164° 59.42'E
818	4 Oct 84	26 Oct 85	37° 02.59'N 165° 02.40'E
817	2 Oct 84	27 Oct 85	34° 59.66'N 164° 59.65'E
816	30 Sep 84	27 Oct 85	33° 00.30'N 164° 58.90'E
815	29 Sep 84	28 Oct 85	31° 02.13'N 164° 55.05'E

Moorings Deployed

No.	Date Launched	Posi	tion
* 832	10 Oct 85	20° 49.5'N	158° 24.6'W

Mooring deployed for Extended Duration Subsurface Mooring Project.

Table 17

R/V Thomas G. Thompson, Cruise Number 191 Leg II

Honolulu - Guam, 10 Oct 85 - 2 Nov 85

1.	George H. Tupper	Chief Scientist	WHOI
2.	William M. Ostrom	Mooring Supervisor	WHOI
3.	Sean M. Kery	Mooring Technician	WHOI
4.	Bryan S. Way	Current Meter Technician	n WHOI
5.	Brian Littlefield	Current Meter Technician	n WHOI
6.	John H. Thomson	Current Meter Technicia	n WHOI
7.	Scott E. Worrilow	Release Technician	WHOI
8.	Ellen Levy	Data Processor	WHOI
9.	Thomas Leahman	Marine Technician	University of Washington

moorings of the ZONAL array, take XBTs every fifteen miles along 175°W. and 165°E. between the moorings, and launch a near-bottom extended subsurface test mooring near Honolulu.

The R/V THOMAS G. THOMPSON sailed from Honolulu at 1600 local time. The first task was the launch of mooring 832, an extended test of two releases and two current meters just recovered from the two-year moorings (Fig. 19). A fresh release with a two-year battery is at the bottom of the mooring as the active release. The goal of the program is to evaluate the three to four year potential of our instruments.

After the launch, the ship headed northwest toward mooring 824 (Fig. 20) On the way, a seaman suffered a head injury severe enough to divert us to Midway Island. After he was examined and treated, the ship sailed again, headed for mooring 824, but he had a seizure, making a second diversion to Midway necessary. This cost about two days of shiptime, but the good weather helped make up the difference by allowing faster cruise speeds.

All the moorings were recovered routinely except for the last one, number 815. As the third cluster of balls was taken aboard, somehow a turn of wire wound around the sheave and broke. This meant that the release and the bottom cluster of balls was free of the ship, about a mile away, on a dark night. The acoustic towfish was re-deployed over the stern and we began ranging on the release, using the clocked keyer to send out an interrogate pulse precisely every two seconds. With the echo sounder on the two second sweep, the range to the release was displayed graphically, making it a simple matter to steer the

ship to the release. It was sighted when about 100 yards ahead.

After this recovery, the ship steamed southwest, arriving in Guam on the 2nd of November, 1985.

Table 16 summarizes the mooring work on leg II. Cruise personnel appear in Table 17.

IV. RESULTS, IMPROVEMENTS, PROBLEMS

A. Data_Return

Figure 21 shows the overall data return for the 20NAL experiment. Each current meter symbol represents the two years of the array. The top half represents the first year of the deployment, the bottom half represents the second. For example, a totally black symbol means that the data was good both years; white on top half, black on bottom means bad first year. good second year. The partial symbol represents a current meter whose battery ran down early. If a current meter did not record current speed and direction, but recorded temperature and pressure, it was called bad (white).

B. Wire Re-use

During the planning of the ZONAL array, it was realized that 12 of the moorings would be turned around (recovered and redeployed) after the first year. Careful attention to the design of the moorings and care during recovery at sea has resulted in the successful re-use of a large percentage of the mooring wire and Kevlar. Short, "sacrificial" shots (lengths) of wire were designed into the moorings near the glass ball clusters to bear the brunt of the tangles usually found there, leaving the long shots to survive virtually tangle-free. Of 41,000 meters of mooring wire, 28,600 meters, or 70% was re-used. Of 22,000 meters of Kevlar, 17,900 meters were re-used, or 81%.

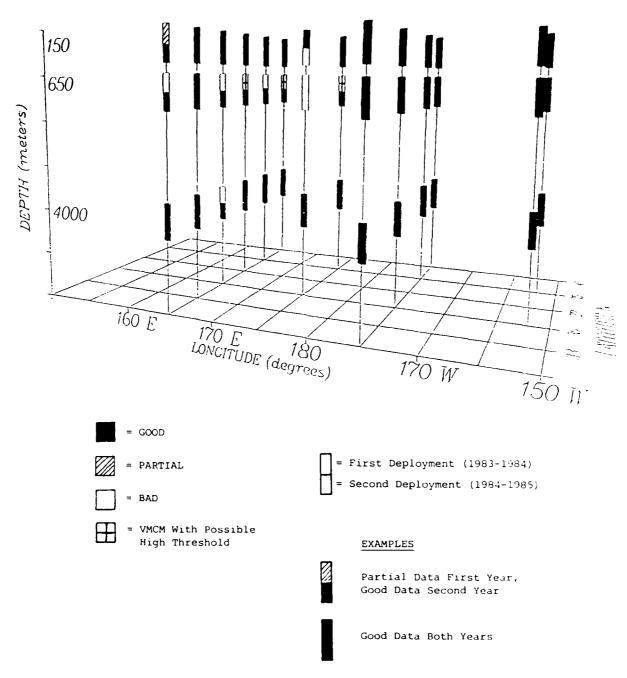


Fig. 21 Data Return, ZONAL Pacific Experiment

C. Release Tracking Using PGR and Towfish

Two things have combined to make re-location of moorings with acoustic releases easier.

- 1. A clock has been built to trigger the transponder output pulse from the deck gear at precise intervals. This allows a visual presentation of the range to the release on the PGR, or echo sounder.
- 2. An inexpensive towfish has been built which can be towed by the ship at speeds up to 6 knots. The acoustic transducer is mounted in this fish, allowing release interrogation and ranging without stopping the ship. Hull-mounted transducers are another alternative, but not all ships have public transducer wells. Hull mounts also pick up a fair amount of ship's noise and when the weather is rough, cavitation, bubbles, and heaving in and out of the water make them less than ideal acoustic receivers.

The usefulness of this technique was demonstrated during the recovery of the last ZONAL mooring, number 815, in the middle of the night of 27 October, 1985. For some reason, the wire near the third glass ball cluster fouled on the rehaul sheave, breaking the wire, leaving the bottom cluster of glass balls with the release hanging under it drifting free about a mile from the ship. The towfish was re-deployed over the stern and began interrogating the release at two second intervals. With the PGR on a two second sweep, the range to the release could be easily seen. The ship got under way and was guided to the ball cluster in 28 minutes. In 1981 an identical thing happened during the recovery of mooring 703 (Bradley, P. 25). Re-locating the ball cluster at night without this system required six hours.

D. Release Problems

1. Acoustic Release Implosion, Mooring 805, 3 Dec 83

It is still unclear why release number 601 imploded on mooring 805. It had been owned by the group for 10 years and had been deployed many times at depths greater than 5,000 meters for periods of one year. 6,236 meters was, however, the deepest it had been. One clue, perhaps, is the fact that a glass ball about two meters away had imploded also. This raises the possibility of sympathetic implosion. Even if that is what happened, we don't know which one caused it. Logic says the ball did it, because I have seen many imploded balls and only one imploded instrument, but the facts are that we will never know for sure.

2. Release Actuation after Deployment-Mooring 820, 6 Oct 84

On inspection after the failure, pins J and K of circuit connector J4 were found to arc when the pinger pinged, causing a false fire signal. Why it didn't show up when lowered to 2,000 meters for testing was not clear. Subsequently, in February.

1985, it was rejected from being used on a mooring for failing the air acoustics pre-launch checks. The transducer ceramic was subsequently found to be cracked, and was replaced. The problem with arcing could not be duplicated, but it is conceivable that a cracked transducer could shift position under great pressure. If

it shifted to a low impedance or shorted position, the pinger circuitry could be overloaded to the point of arcing.

This release is presently deployed off Hawaii as the active release on mooring 832, the extended duration subsurface mooring. No problems were encountered during the deployment. In December, 1986, it was interrogated by S. Worrilow and was working fine.

3. Release Firing after Mooring Recovery-Number 502721, Sep 85

This release was stored in the main lab of the ship and fired when a door slammed loudly. This release was badly damaged near the transducer area during recovery. It got caught under the stern of the ship and the transducer protective cage was ripped off. Mechanical shock has to be suspected here, since the release stayed in the water for two years without firing prematurely. On inspection, the listening amplifier was very noisy and needed replacement, and the D1 board was found to be out of tune and would receive receiver 2, 3, 4, and 5.

4. Release No. 324, Failed to Release, Mooring 794, 1 Oct 85

On inspection, the squib firing battery was dead. In the lab this was traced to a leaky squib. This is a very disturbing malfunction, because every squib which goes into a Buoy Group release is checked for leakage. The only conclusion that fits is that sometime during the deployment, the squib began to leak, drawing down the firing battery.

E. VMCM Problems

Of the seven VMCMs deployed in the first setting of ZONAL, 1983-1984, one flooded, three had water in the sting, and the remaining three had suspicious rotor drop-out problems. Jim Valdes, Head of Buoy Group Technical Support, has spent much of his time troubleshooting this problem. The following "ZONAL - VMCM Rotor Report" is his conclusion as to what was wrong with the first setting of VMCMs in ZONAL.

ZONAL - VMCM Rotor Report

Summary

ያለተያለም ያለም የሚያስለ የሚያለም የሚያስለም የሚያስለም የሚያስለም እና ለተጠብ የሚያስለም የሚያስለም ለተጠን ለመስከት ለተጠቃ ለሚያስለም ለተጠቃ የሚያስለም የሚያስለም ለ

The first group of Vector measuring Current Meters recovered from the ZONAL Pacific Array presented several unique problems. Three of the instruments experienced flooded stings and four others had rotor problems characteristic of missing counts (Fig. 22, 23). Figure 23 is a typical VMCM time series; note the smooth transition through zero for Rotor 1 and Rotor 2. Figure 22 is a time series from ZONAL I; note the disconinuity about zero.

Background

This was the first major deployment of VMCMs several hundred meters deep on subsurface moorings. The deployments prior to ZONAL had been on surface moorings under a toroid (CODE) or discus (LOTUS) buoy. The results from LOTUS were disappointing. The bearing assemblies in the VMCMs were literally falling apart from the dynamics under the buoy. In an effort to reduce the axial forces on the bearing assemblies, the bearing endplay was reduced to zero, effectively preloading the bearings. In the presence of this preloading the dynamics introduced by the surface float are adequate to maintain the VMCM rotors above threshold, those on a quiet subsurface mooring are not. Unfortunately, this assembly procedure carried through to those instruments prepared for deployment on ZONAL as well.

The VMCMs recovered from the first setting of the 20NAL

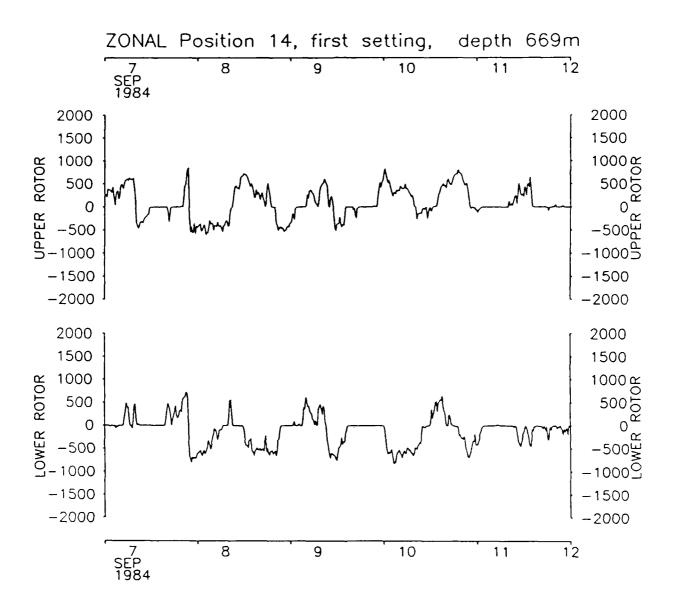


Fig. 22 A VMCM data record from the first year's ZONAL deployment (1983-1984)

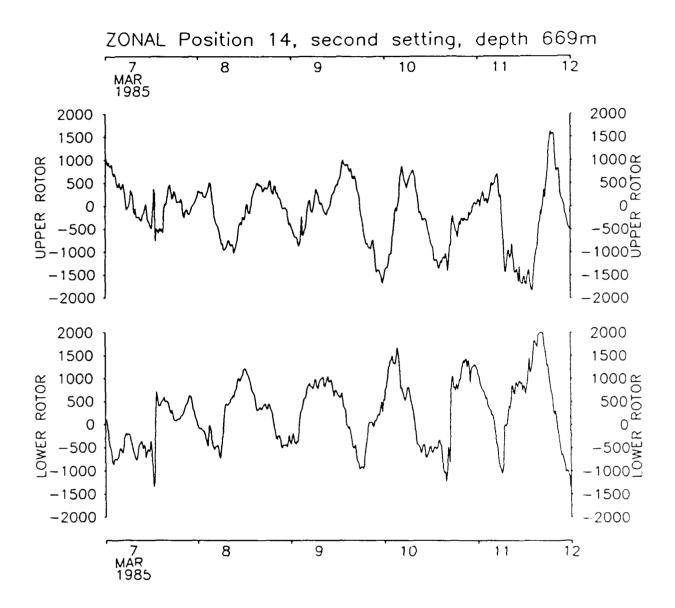


Fig. 23 A VMCM data record from the second year's ZONAL deployment (1984-1985)

array exhibited several electro-mechanical problems, most of which were related to the sting assembly. An analysis of the hub assembly indicated the possibility of inadequate O-Ring compression between the window and the face as well as an interference fit between a foil run on the Sony board and the shoulder on which it rests. This contact resulted in the Sony signal being shunted to ground with a corresponding loss in rotor counts. The interference problem is aggravated with depth. As the ambient pressure increases the likelihood of contact increases. Of the seven instruments recovered from ZONAL I, three had shallow-water leaks in the sting, one main housing leaked, and the remaining three had rotor dropout problems.

After the recovery, our efforts concentrated on trying to duplicate the problem in the laboratory. These tests indicated that the Sony interference would duplicate the dropout over a very narrow range of signal leakage to ground. In retrospect, this was most likely not the cause of our rotor failures. The faulty diode boards were redesigned and replaced. More importantly, the instruments were modified to permit a vacuum to be pulled on the sting assembly. The vacuum ensures that all O-Rings are properly seated, thus precluding any possibility of shallow-water leaks.

After completing these modifications a short-term subsurface mooring was set to test the VMCMs, with a VACM included as a reference. The results were shocking. It appeared as though all of the VMCMs had rotor dropout problems similar to those observed on ZONAL I. One improvement was noted; none of the instruments

leaked. An evaluation, using the reference VACM, suggested a VMCM rotor threshold of nearly 6 cm./sec. This indicated a mechanical problem as the instruments tested fine electronically in the cold. After recovery the instruments had been placed in a cold chamber at 3° C. for monitoring. Mechanically the rotors seemed a bit sluggish. Some would turn freely in the recirculating air of the cold chamber and others would not. Rotor shaft endplay was noted as .000/.001 in., an indication that the bearing assemblies were preloaded. At room temperature the endplay was noted as .001/.002 in. and the rotors turned freely. Clearly, there was a mechanical binding at the low temperature. An analysis of the hub assembly revealed a differential shrinkage due to temperature of .0012/.0015 in., between the stainless steel shaft and the aluminum hub combined with the delrin endcap. In addition, the procedure recommended for affixing the bearings to the shaft was in error. The method utilized recommended a shaft endplay of .003/.005 inches before the bearings were locked to the shaft, which is essentially the internal clearance of the bearings. After locking the bearings in place the endplay at room temperature is .000/.001 in. one considers the shrinkage due to temperature it's obvoius that there will be a problem. In a related item, the inside of the delrin cap also shrinks by .001 in., effectively grabbing the outer race of the bearing, fixing it in position relative to the hub. The procedure for locking the bearings on the shaft evolved during the LOTUS program in an effort to prolong the life of the bearings. Post-LOTUS accelerated lab tests suggested that

locking the inner race to the shaft significantly prolonged the life of the bearings.

This was a satisfactory explanation for the results of the test mooring but not for ZONAL I. Those bearings had not been . fixed to the shaft. In the intervening period ZONAL II was recovered and yielded nearly 100% data return. Why? During the time ZONAL I was in the water several of the mechanical parts of the hub assembly were "fine tuned" to ease in assembly. New shafts were procured. This new design provided tenths of a thousandth clearance between the shaft and the inner race of the bearing. The older shafts had essentially been a press fit.


This, I believe, was the ZONAL I scenario - the shaft endplay was set to .003 in., and the bearings were a tight fit on the shaft. At depth, the decrease in temperature locked the bearing in the endcap and the differential shrinkage preloaded the bearings resulting in a high rotor threshold. Examination of the records suggests a threshold in the order of 3 to 4 cm./sec., for those instruments which did not flood. Unlike the more conventional VACM which has a unidirectional sensor, the VMCM has two rotors mounted orthogonally on the sting, which reverse direction of rotation in response to the driving current. We then are dealing with the cosine response of the sensors and their individual thresholds. The only significant difference between the settings of ZONAL I and II was the fit between the bearings and the shaft. Clearances were again .003 in., minus the shrinkage of .0015 in., leaving approximately .001 in. of endplay remaining IF the inner race of the bearing can slide on the shaft.

Since the ZONAL experiment, the procedures for setting and verifying the instrument bearing clearances have been modified.


All instruments are checked in the cold chamber prior to deployment and all endplays are noted. As a final check, the shaft is tested to ensure that it is free to turn and is able to cog in the cold due to the attraction between the Sony diodes and the magnetic pick-up.

V. ZONAL MOORING DRAWINGS


This section contains every mooring launched or recovered for the ZONAL experiment. They are presented in the order they were launched, beginning with mooring 793. 793, 794, etc. are the WHOI Buoy Group Mooring Numbers, assigned sequentially as moorings are launched by the group. The "ZONAL NUMBER", 1-14, is simply a way of identifying the mooring's position in the array and was assigned long before the moorings went in the water. The instrument data numbers consist of the mooring number followed by a single digit signifying the vertical placement of the instrument in the mooring. For example, data number 7943 is the third current meter from the top on mooring 794; 8251 is the data record from the top current meter on mooring 825.

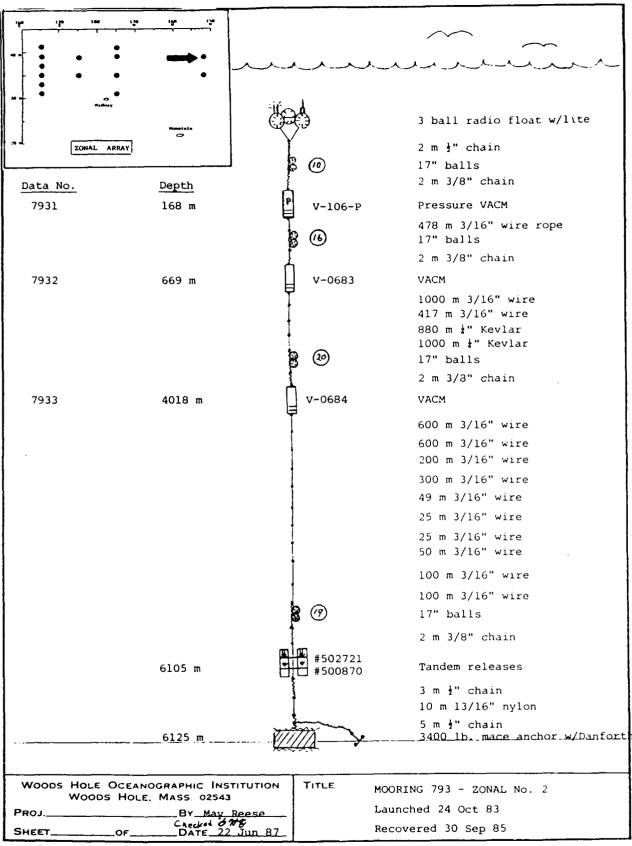


posted recocosa Vannondo incoposado responda espondes acospera. Espanos espanos

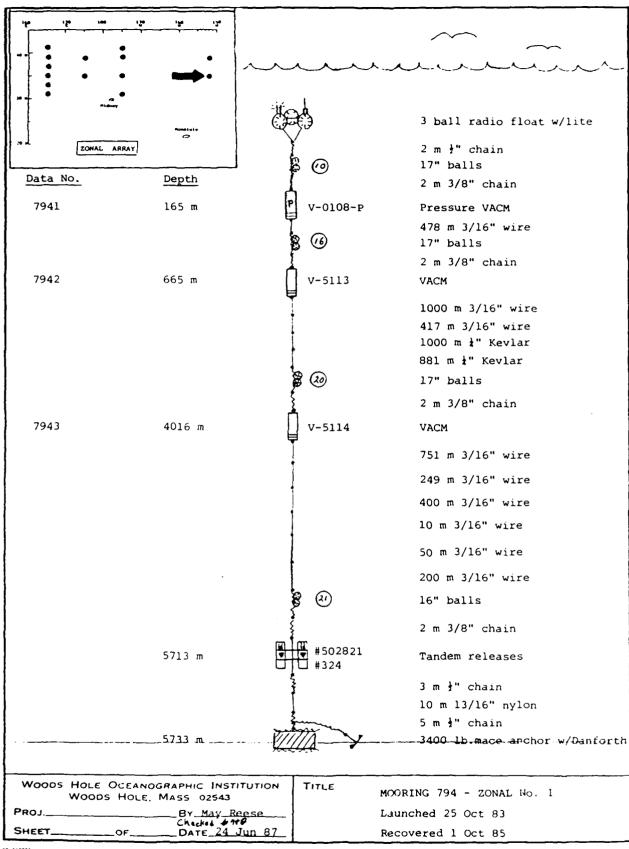


SP 11288A

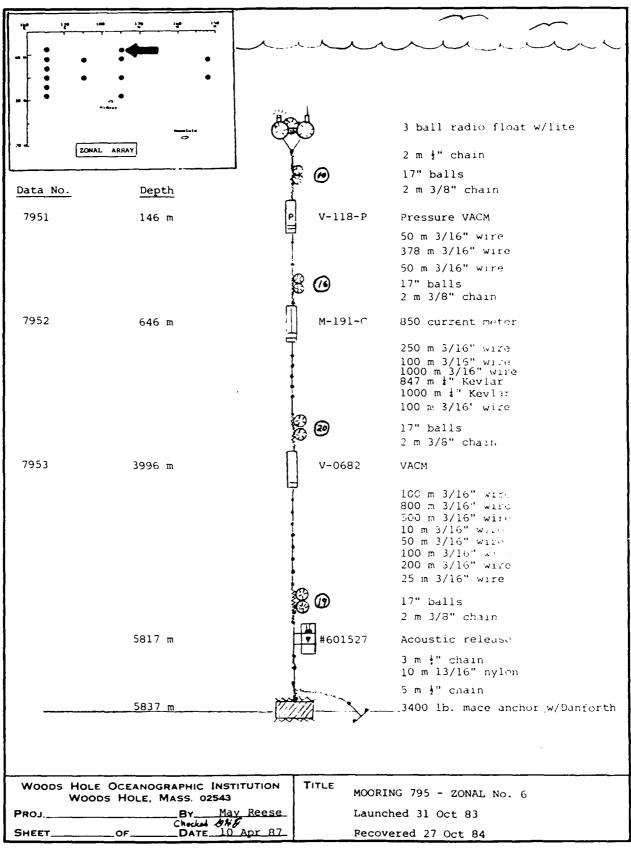


SP 11798A

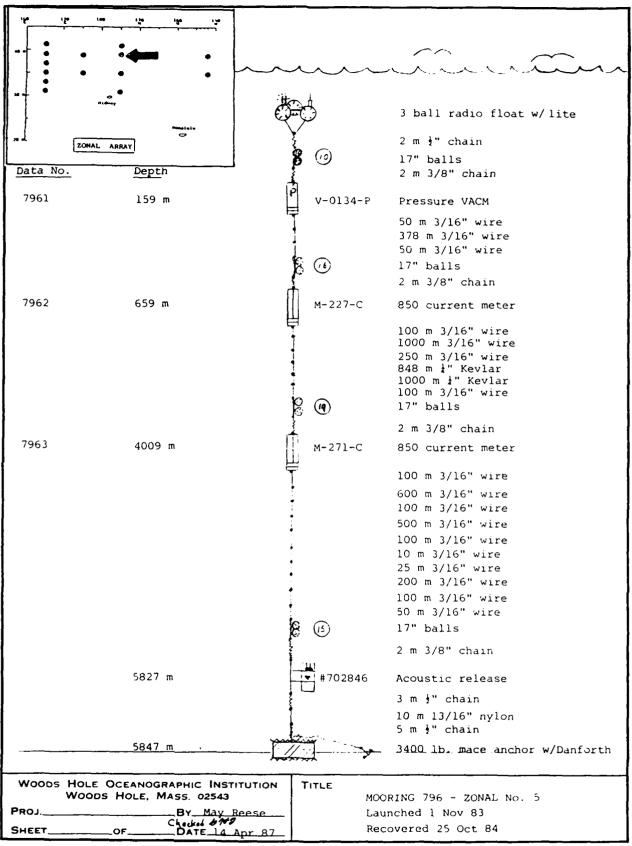


SP 11288A

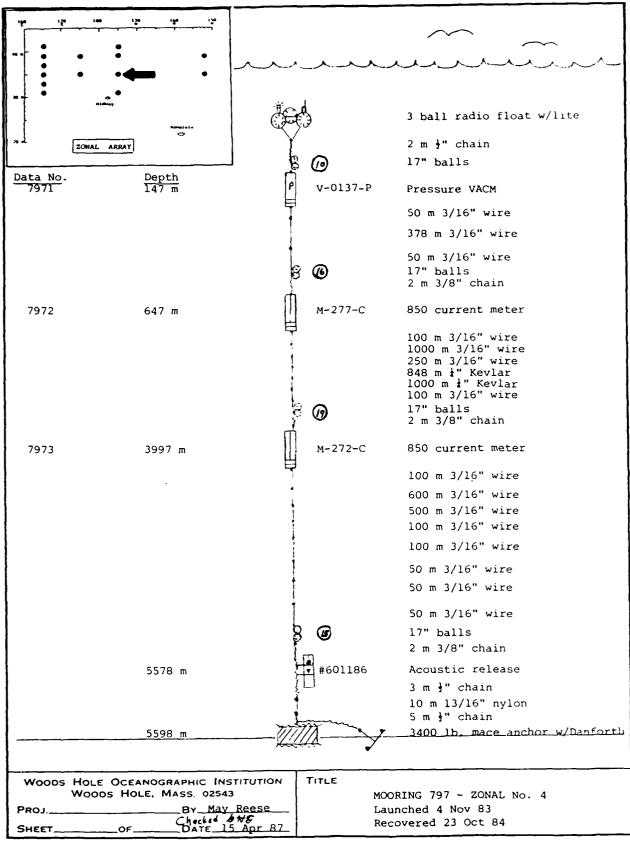

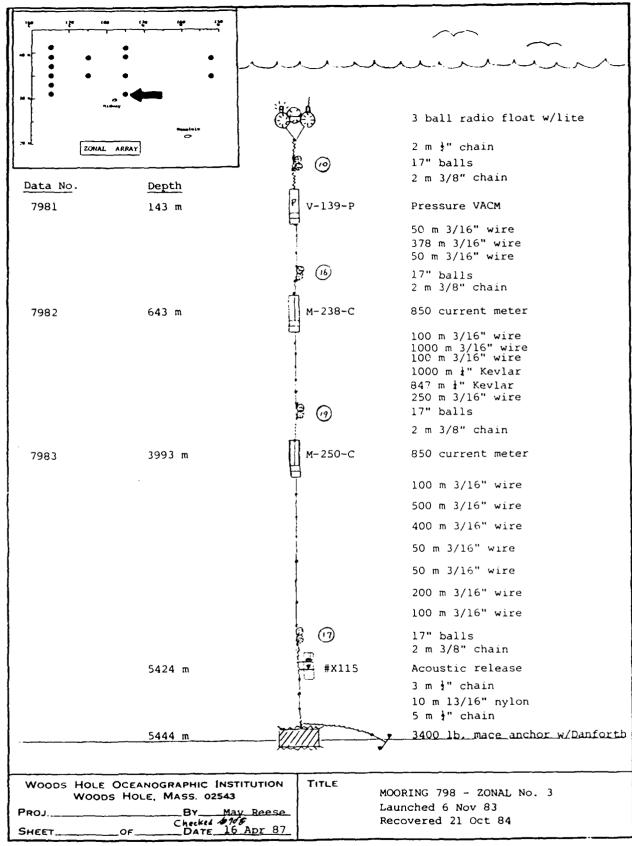


SP 11288A

ዸቔኯፙቔኯኯቔፙቔዀዸቔፙቔኇዸቔፚቝዄቔዀቔቔፙቔቔፙቔኇኯኯኯፙቔፚዾቔፙቔፙቔፙቔቜዾቔፙቝዀቔዀቔቜቔቔ

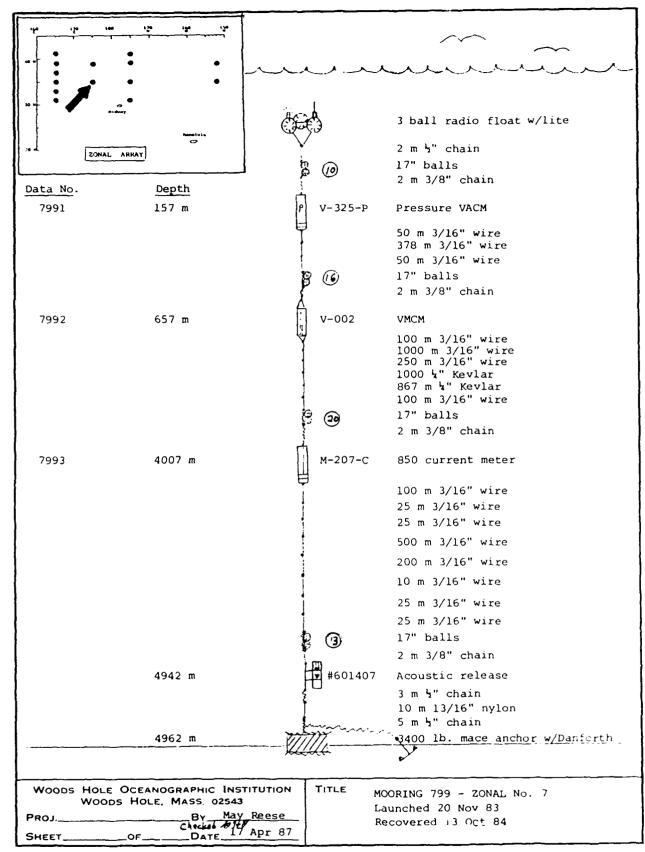


SP 117**85**A

TOTAL RESERVED BOSCOCKER OF STREETS ROBBINS BESTELLE OF STREETS OF STREETS

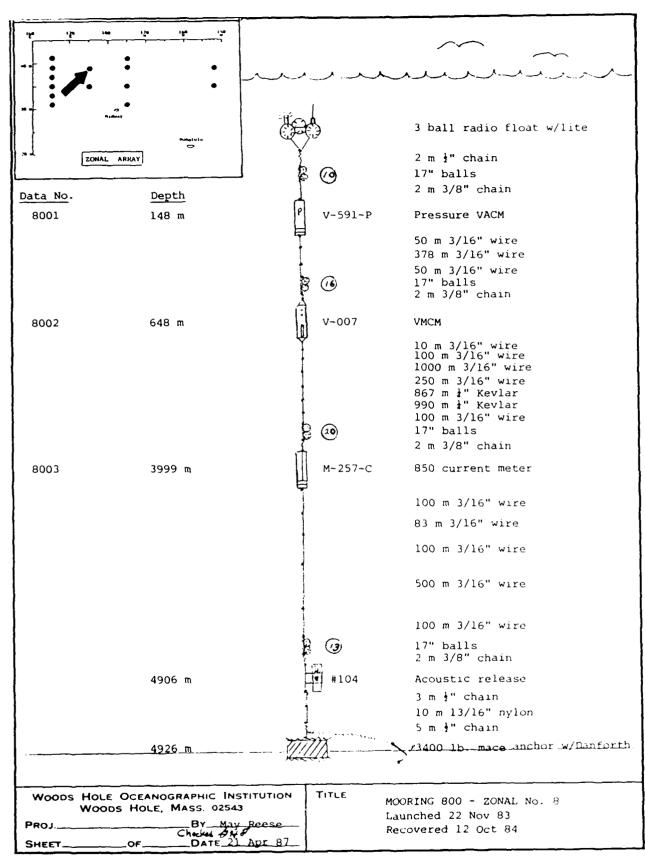



SP 11200A

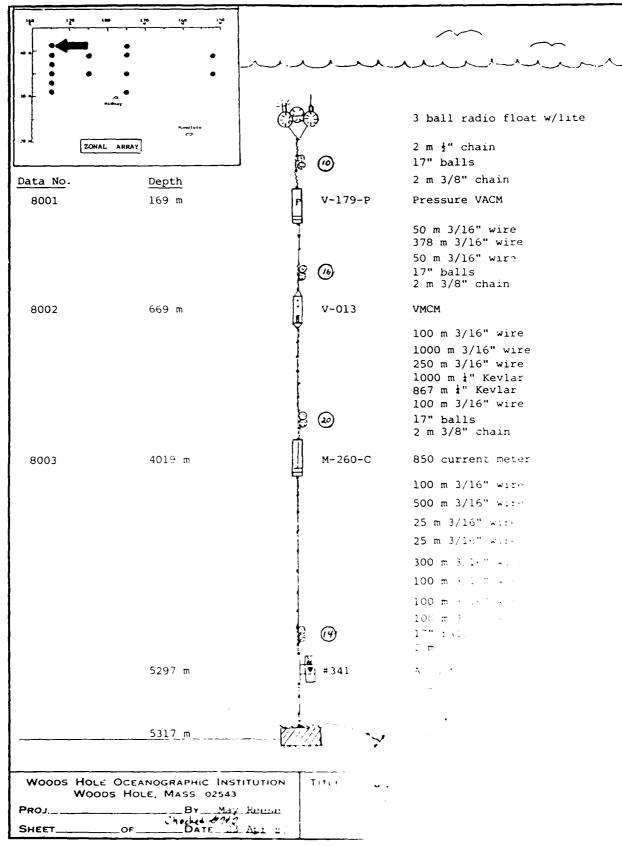


TO THE PARTY OF TH


SP 11788A

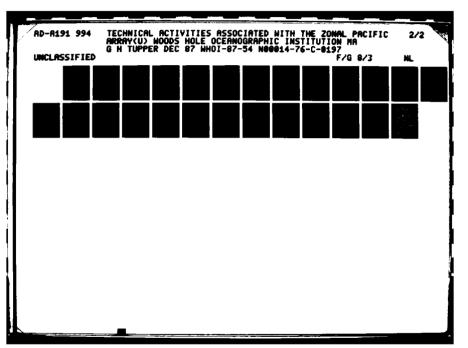

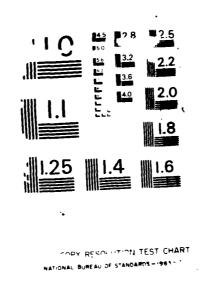


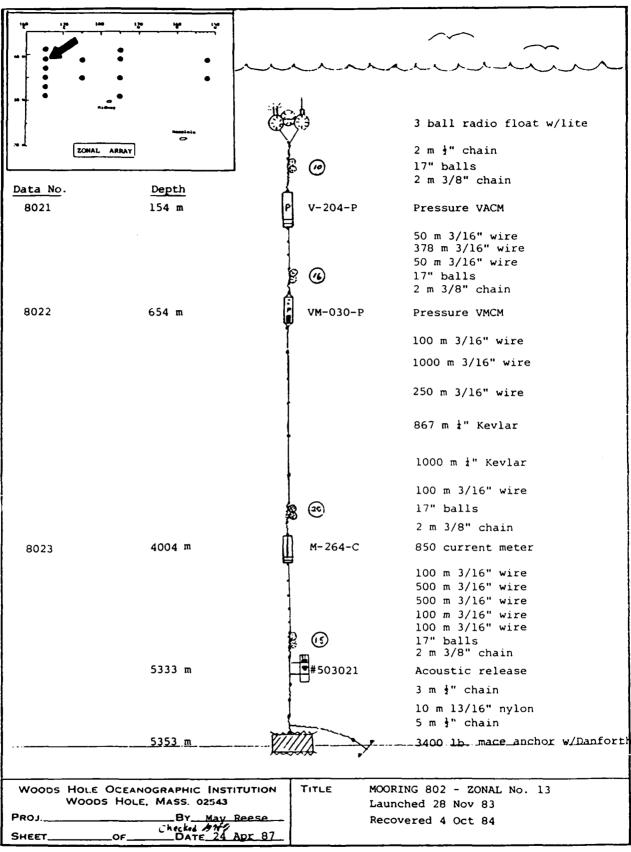


SP 11786A

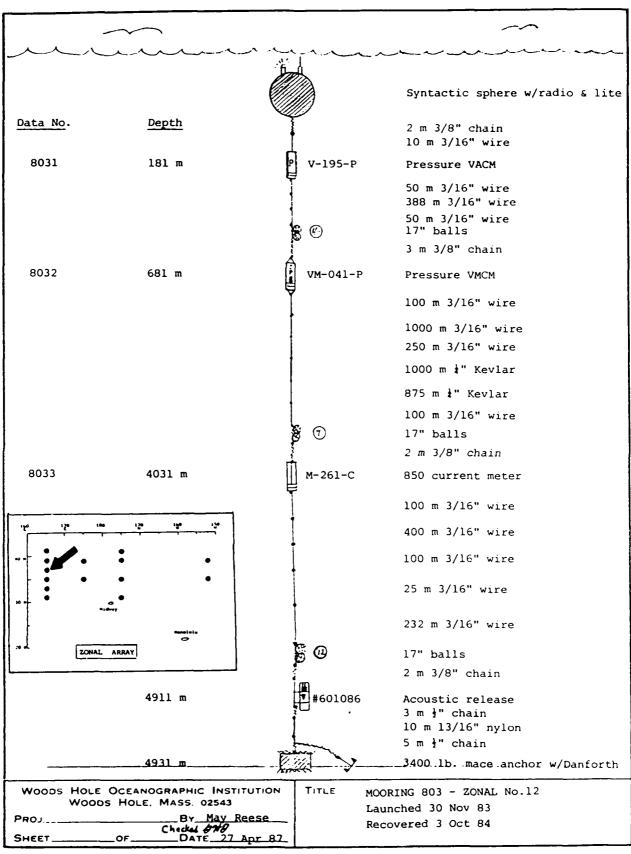


SP 11288A

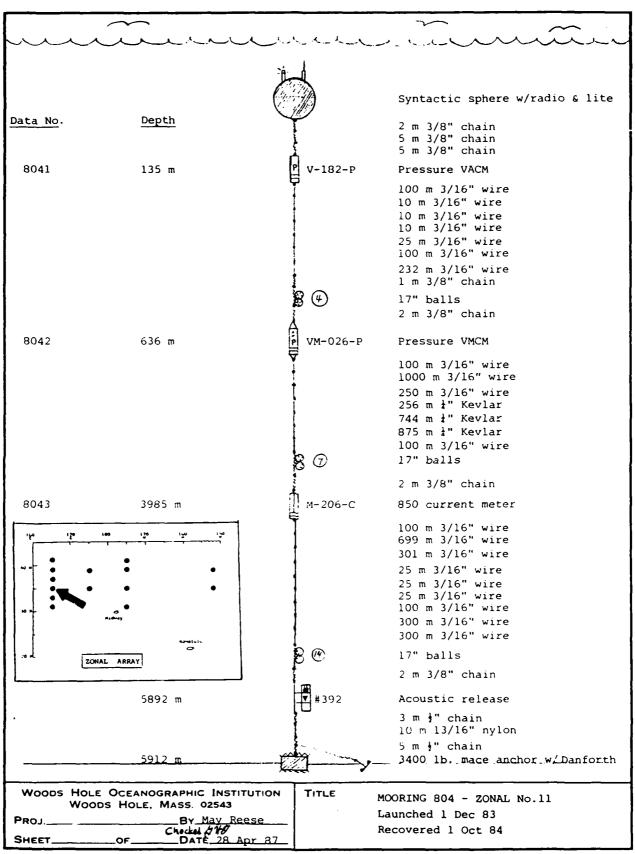


SP 11286A

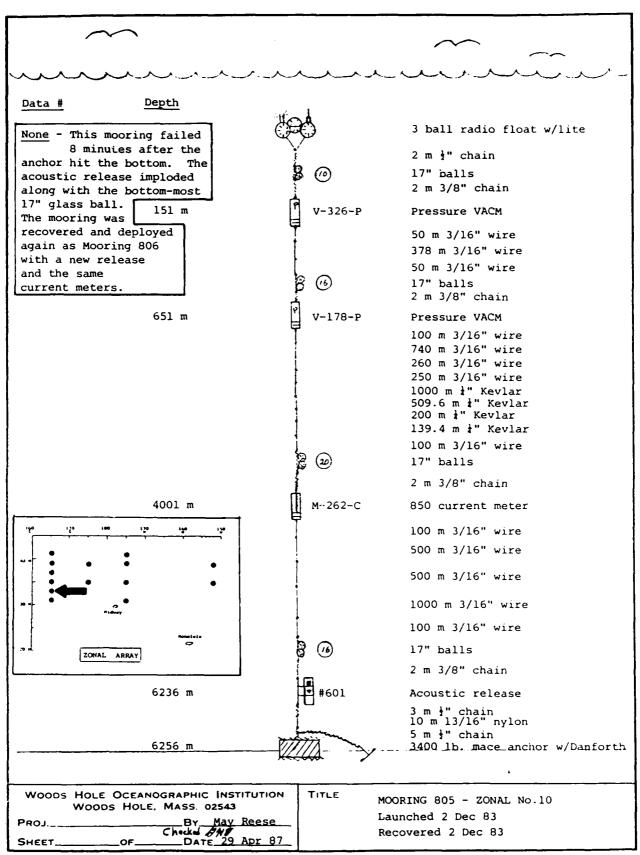


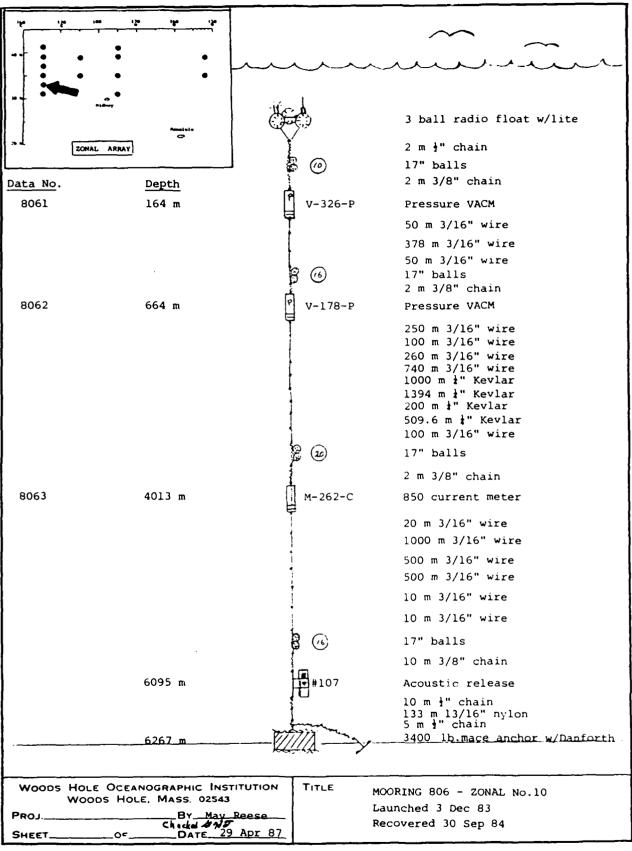



SP 11298A

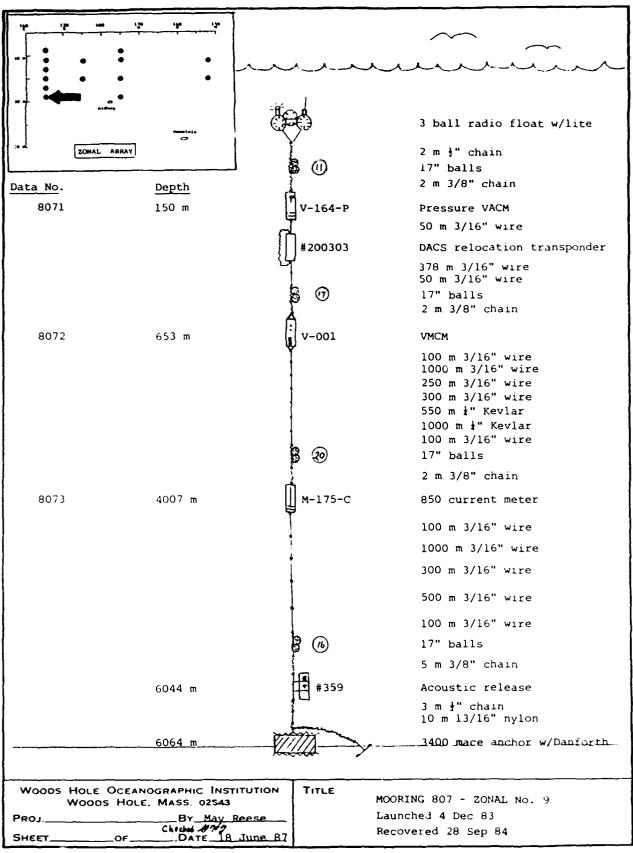


SF 117884

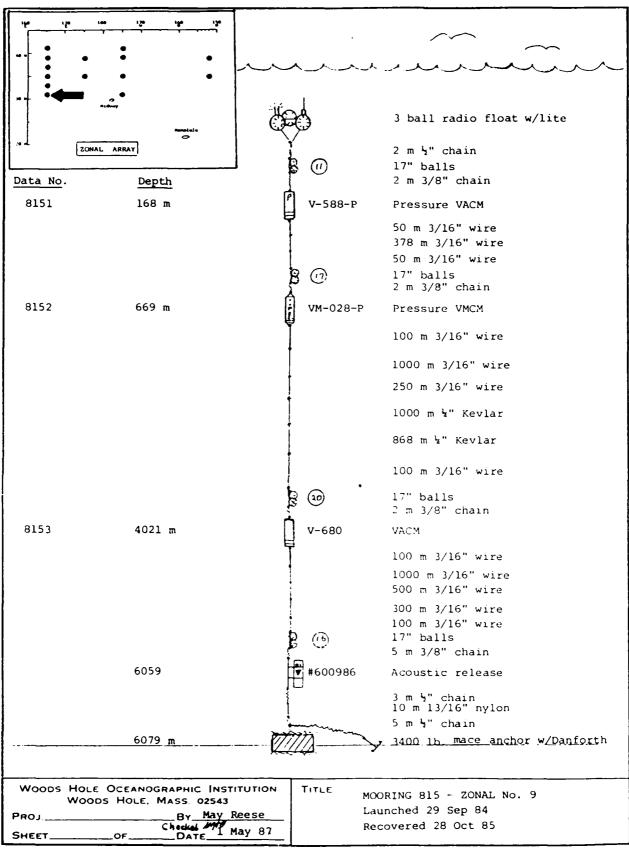


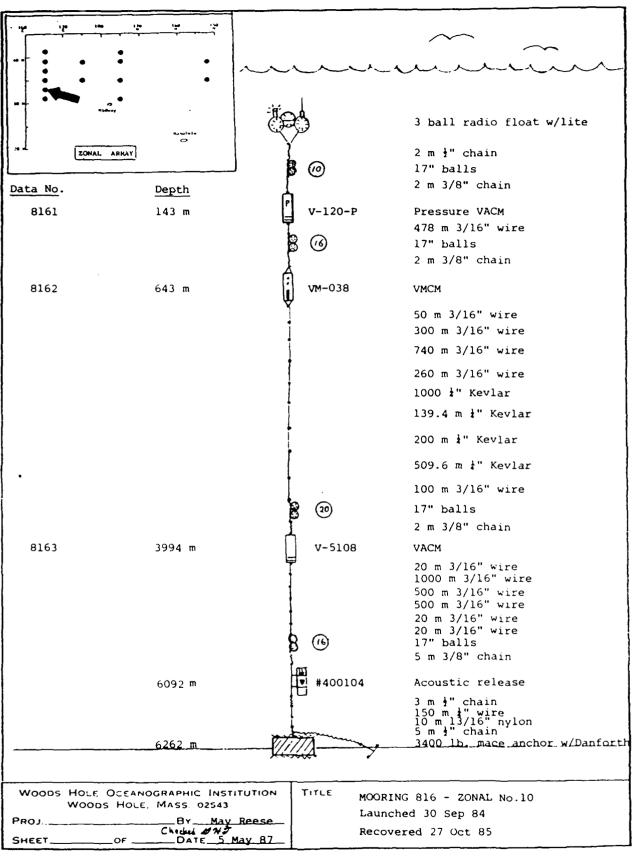

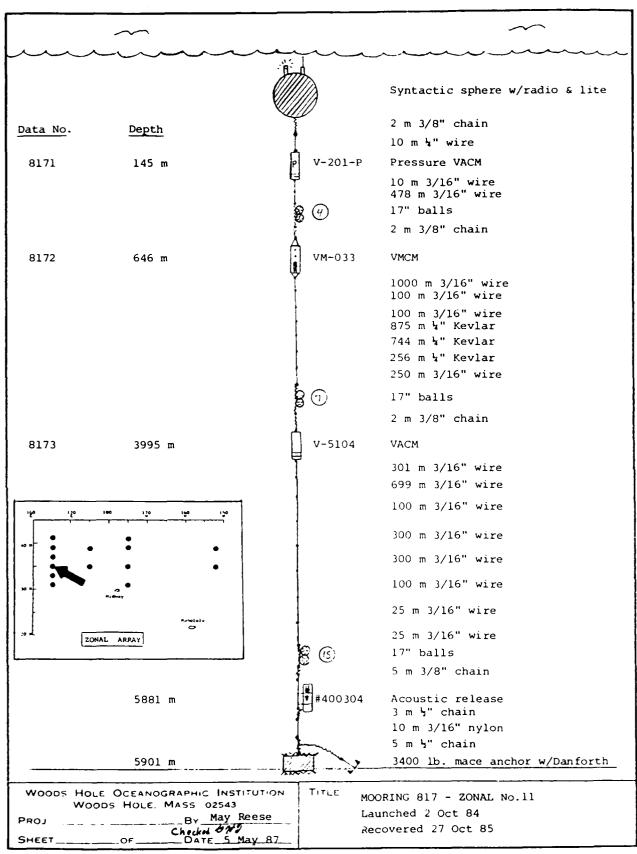


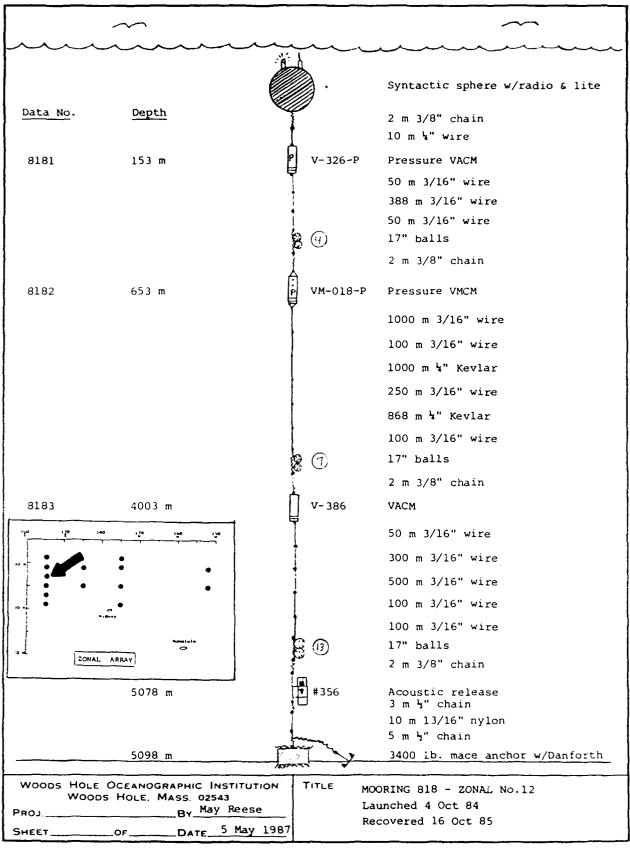


SP 112884

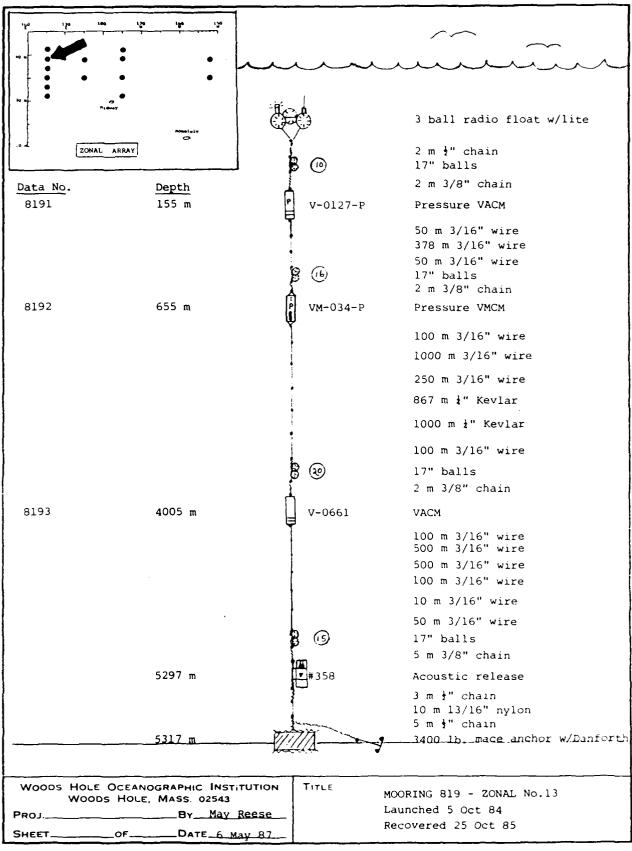


SP 11288A

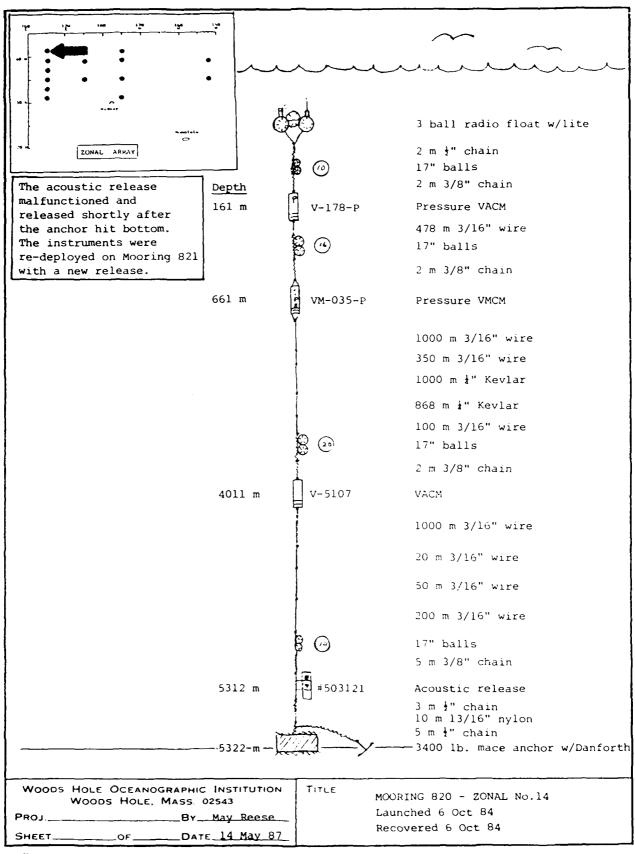


SF 11288A

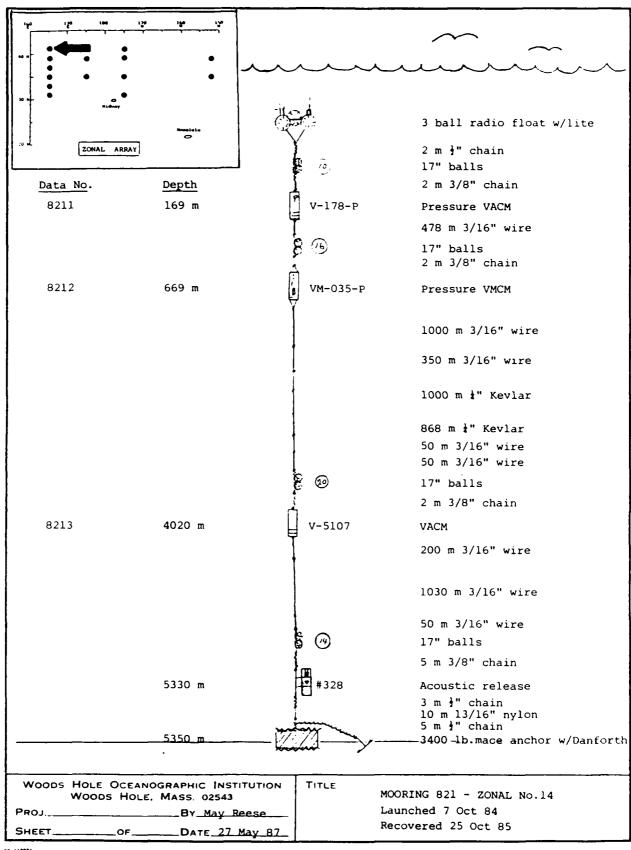

SP 11288A

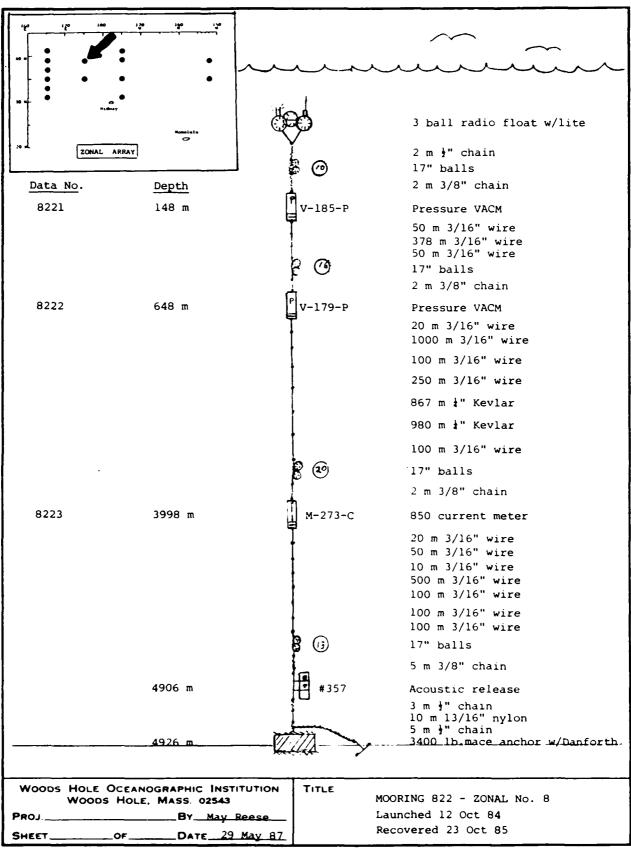


SP 11798A

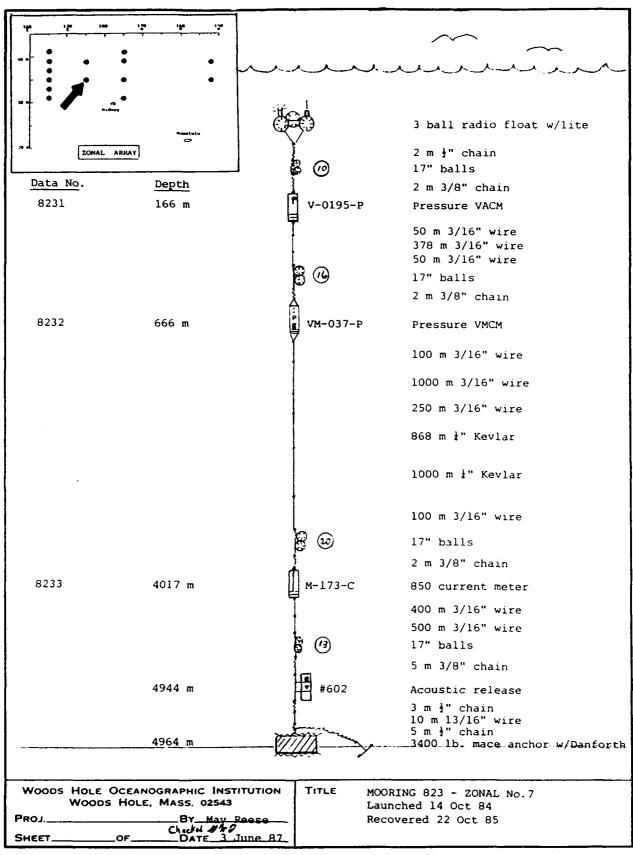



en la la companya de la companya de

SP 11206A

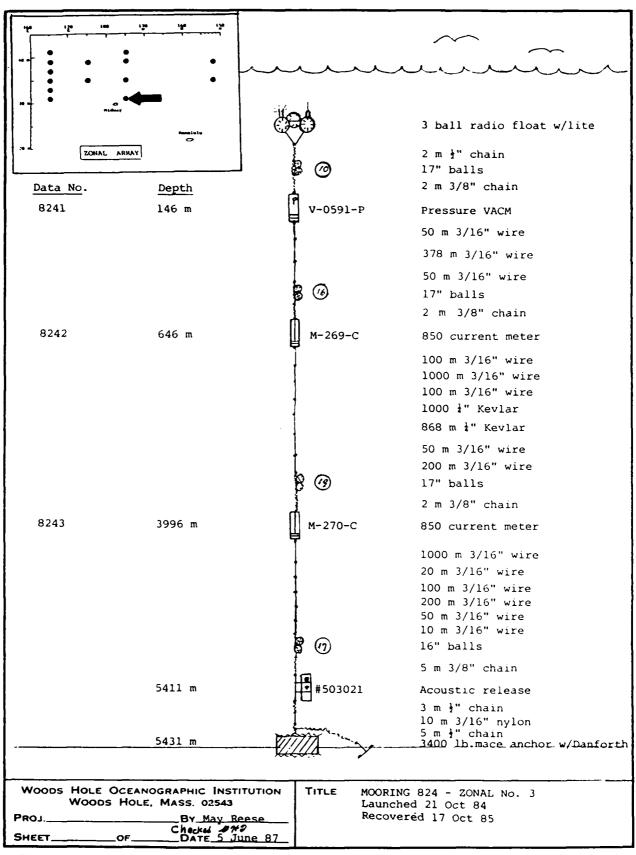


SP 11706A

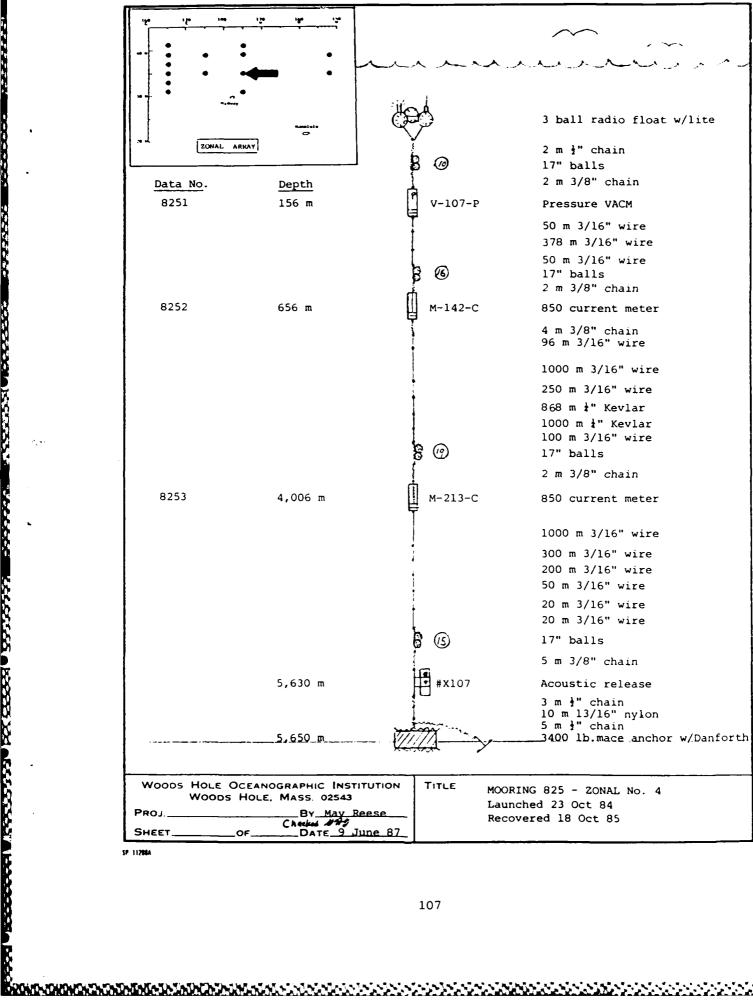

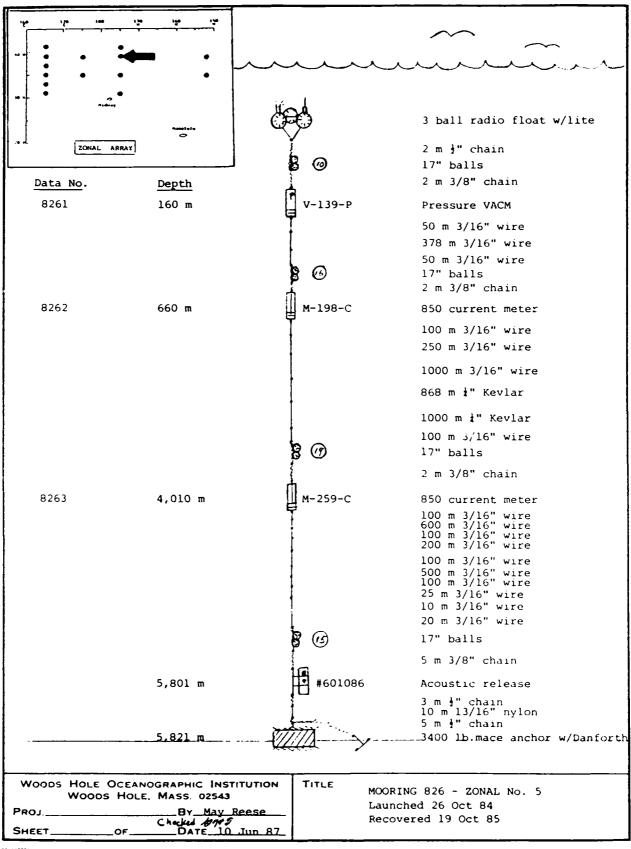

SP 117864

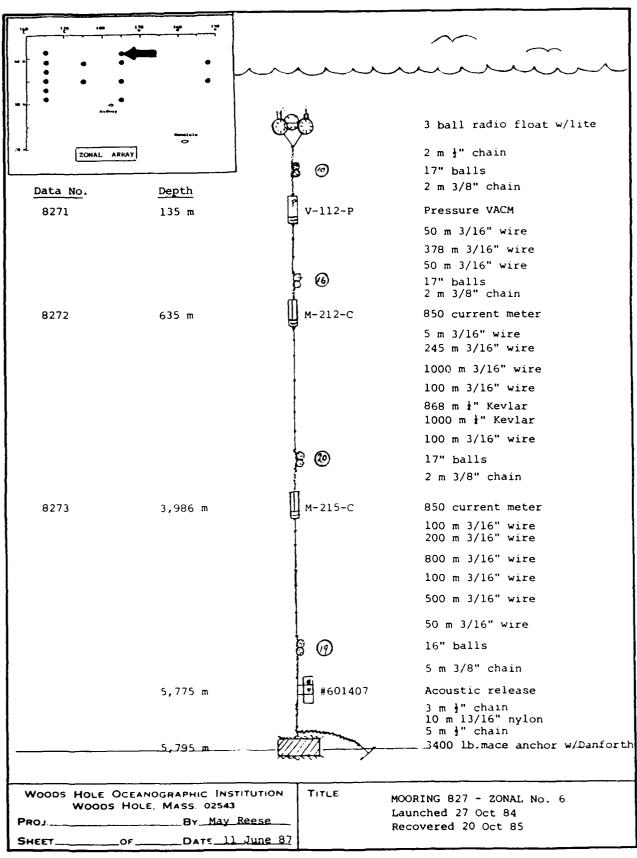

SP 11706A

Acknowledgements

The success of this experiment is due to the efforts of a great many people. The dedication and professionalism of the people in the Buoy Operations, Technical Support, and Data Processing groups are gratefully acknowledged. Special thanks are due to David Simoneau and Will Ostrom for their outstanding performance supervising deck operations in sometimes abominable weather conditions, to Joe Poirier for supervising the current meter preparations which led to the high data return, and Scott Worrilow and Roderigue LaRochelle for their expertise in acoustic release preparation which resulted in no lost moorings. Thanks also to May Reese, who made all the mooring drawings and helped enormously in editing and organizing this report. I also wish to thank all cruise participants for their efforts and cooperation in often less-than-ideal conditions.

Captain C. W. Clampitt and the officers and men of the Rev Thomas G. Thompson were greatly appreciated by all of us for their seamanship, professionalism, and general "can-do" attitude. In particular, Captain Clampitt's shiphandling when approaching moorings on the surface in rough weather was outstanding, resulting in successful pickup on the first approach in most cases. This, in turn, assured minimum tangling of the mooring and maximum re-usability of the mooring wire during the 1984 turnaround cruise.

The mooring work was supported by the Office of Naval Research under Contracts N00014-76-C-0197, NR 083-400 and N00014-84-C-0134, Nr 083-400.

References

- Berteaux, H.O. and B. Prindle (1987) Deep Sea Moorings Fishbite Handbook.

 Woods Hole Oceanogr. Inst. Tech. Rept. WHOI-87-8. Woods Hole, MA
- Bradley, K.F. (1982) Technical activities associated with an exploratory array in the western North Pacific. Woods Hole Oceanogr. Inst. Tech. Rept. WHOI-82-41, Woods Hole MA
- Chase, T.E., H.W. Menard and J. Mammerickx (1977) Topography of the North Pacific. <u>Tech. Rep. Seri. TR-17</u>, Inst. of Mar. Resources, Univ. of Calif., La Jolla
- Holland, W.R. and W.J. Schmitz, Jr. (1985) Zonal penetration scale of model
 mid-latitude jets. J. Phys. Oceanogr. 15, 1859-1875
- Koblinsky, C.J., R.L. Bernstein, W.J. Schmitz, Jr. and P.P. Niiler (1984) Estimates of the geostrophic stream function in the western North Pacific from XBT surveys. J. Geophys. Res. 89, 10451-10460
- Levy, E. and S.A. Tarbell (1983) A compilation of moored current meter data from the western North Pacific, Volume XXXI, 1980-1982. Woods Hole Oceanogr. Inst. Tech. Rept. WHOI-83-30, Woods Hole, MA
- Levy, E. and S.A. Tarbell (1987) A compilation of moored current meter data from the North Pacific (The "Zonal" Experiment, 1983-1985), Volume XLI.

 Woods Hole Oceanogr. Inst. Tech. Rept. WHOI-87-20, 54 pp. and 8 microfiche
- Moller, D.A. (1976) A computer program for the design and static analysis of single-point subsurface mooring systems: NOYFB. Woods Hole Oceanogr. Inst. Tech. Rept. WHOI-76-59, Woods Hole, MA
- Niller, P.P., W.J. Schmitz, Jr. and D.K. Lee (1985) On the geostrophic volume transport in high eddy energy areas of the Kuroshio Extension and Gulf Stream. J. Phys. Oceanogr. 15, 825-843
- Schmitz, W.J., Jr. (1984a) Abyssal eddy kinetic energy in the North Atlantic. J. Mar. Res. 42, 509-536
- Schmitz, W.J., Jr. (1984b) Abyssal eddy kinetic energy levels in the western North Pacific. J. Phys. Oceanogr. 14, 198-201
- Schmitz, W.J., Jr. (1984c) Observations of the vertical structure of the eddy field in the Kuroshio Extension. J. Geophys. Res. 89, 6355-6364
- Schmitz, W.J., Jr. (1987) Observations of new, large, and stable abyssal currents at mid-latitudes along 165E. J. Phys. Oceanogr. 17, 1309-1315
- Schmitz, W.J., Jr. (1988) Zonal exploration of the North Pacific. J. Phys. Oceanogr. 18, in press

የመመደብ እና እና እንደነገሩ እንደነገሩ

- Schmitz, W.J., Jr. and W.R. Holland (1982) A preliminary comparison of numerical eddy-resolving general circulation experiments with observations. J. Mar. Res. 40, 75-117
- Schmitz, W.J., Jr. and W.R. Holland (1986) Observed and modelled mesoscale variability near the Gulf Stream and Kuroshio Extension.

 J. Geophys. Res. 91, 9624-9638
- Schmitz, W.J., Jr., W.R. Holland and J.F. Price (1983) Mid-latitude mesoscale variability. Rev. Geophys. Space Phys. 21, 1109-1119
- Schmitz, W.J., Jr., P.P. Niiler, R.L. Bernstein and W.R. Holland (1982)
 Recent long-term moored instrument observations in the western North
 Pacific. J. Geophys. Res. 87, 9425-9440
- Schmitz, W.J., Jr., P.P. Niiler and C.J. Koblinsky (1987) Two-year moored instrument results along 152E. J. Geophys. Res., in press
- Weller, R.A. and R.E. Davis (1980) A vector measuring current meter. Deep-Sea Res. 27A, 565-582

ĬĬŶŶŶŶĸĊŶĬŶĬŶĬŶĬŶŶŶŶŶŶŶĠŶŶŶŶŶŶŶŶŶŶŶŶŶŶŶŶŶŶ

DOCUMENT LIBRARY

August 21, 1987

Distribution List for Technical Report Exchange

Attn: Stella Sanchez-Wade Documents Section Scripps Institution of Oceanography Library, Mail Code C-075C La Jolla, CA 92093

እየልተናቸው እንዚያ ምርያ ያለርያ እንደተናቸው እንደ

Hancock Library of Biology &
Oceanography
Alan Hancock Laboratory
University of Southern California
University Park
Los Angeles, CA 90089-0371

Gifts & Exchanges Library Bedford Institute of Oceanography P.O. Box 1006 Dartmouth, NS, B2Y 4A2, CANADA

Office of the International
Ice Patrol
c/o Coast Guard R & D Center
Avery Point
Groton, CT 06340

Library
Physical Oceanographic Laboratory
Nova University
8000 N. Ocean Drive
Dania, FL 33304

NOAA/EDIS Miami Library Center 4301 Rickenbacker Causeway Miami, FL 33149

Library
Skidaway Institute of Oceanography
P.O. Box 13687
Savannah, GA 31416

Institute of Geophysics University of Hawaii Library Room 252 2525 Correa Road Honolulu, HI 96822

Library Chesapeake Bay Institute 4800 Atwell Road Shady Side, MD 20876

MIT Libraries Serial Journal Room 14E-210 Cambridge, MA 02139 Director, Ralph M. Parsons Laboratory Room 48-311 MIT Cambridge, MA 02139

Marine Resources Information Center Building E38-320 MIT Cambridge, MA 02139

Library
Lamont-Doherty Geological
Observatory
Colombia University
Palisades, NY 10964

Library Serials Department Oregon State University Corvallis, OR 97331

Pell Marine Science Library University of Rhode Island Narragansett Bay Campus Narragansett, RI 02882

Working Collection Texas A&M University Dept. of Oceanography College Station, TX 77843

Library
Virginia Institute of Marine Science
Gloucester Point, VA 23062

Fisheries-Oceanography Library 151 Oceanography Teaching Bldg. University of Washington Seattle, WA 98195

Library R.S.M.A.S. University of Miami 4600 Rickenbacker Causeway Miami, FL 33149

Maury Oceanographic Library Naval Oceanographic Office Bay St. Louis NSTL, MS 39522-5001 50272 - 101 REPORT DOCUMENTATION 3. Recipient's Accession No. 1. REPORT NO. PAGE WHOI-87-54 5. Report Date Technical Activities Associated with the ZONAL Pacific Array December 1987 7. Author(s) 8. Performing Organization Rept. No. George H. Tupper WHOI-87-54 9. Performing Organization Name and Address 10. Project/Task/Work Unit No Woods Hole Oceanographic Institution II. Contract(C) or Grant(G) No. N00014-76-C-0197, Woods Hole, Massachusetts 02543 (c) NR 083-400 (G) N00014-84-C-0134. NR 083-400 12. Sponsoring Organization Name and Address 13. Type of Report & Period Covered Office of Naval Research Technical Environmental Sciences Directorate Arlington, Virginia 22217 14 15. Supplementary Notes This report should be cited as: Woods Hole Oceanog. Inst. Tech. Rept., WHOI-87-54.

16. Abstract (Limit: 200 words)

Geographical exploration of the eddy and mean fields in the world's oceans using moored instrumentation was concentrated in the North Atlantic in the 1970s. Initial efforts to obtain zeroorder coverage in the North Pacific were begun with an array across the Kuroshio Extension along 152°E with instruments in the water from mid-1980 to mid-1982. An array designed to extend this exploration zonally with long-term moorings east of 152° at mid-latitudes was first set in the fall of 1983, redeployed in the fall of 1984, and recovered for the final time in late 1985. The array was located along four lines of longitude 165°E, 175°E, 175°W, and 152°W. Along the three westernmost longitudes, 24 one-year moorings were used, 12 each year, with three current meters per mooring at nominal depths of 150, 650, and 4,000 meters. The eastern longitude, 152°E, was sampled by two additional moorings, each with 3 current meters at the above depths, which were deployed for a two-year period, a first for the Buoy Group.

This report addresses the technical activities associated with the 1983-1985 array, referred to hereafter as "ZONAL".

- 17. Document Analysis a. Descriptors
 - 1. Current meters
 - 2. Long-term moorings
 - 3. Schmitz ZONAL Pacific 1983-1985
 - b. Identifiers/Open-Ended Terms
 - c. COSATI Field/Group
- 18. Availability Statemen;

Approved for publication; distribution unlimited.

19. Security Class (This Report)
UNCLASSIFIED

20. Security Class (This Page)

21. No. of Pages
113
22. Price

የመደብ የተመሰደት የተመሰደት የተመሰደት የተመሰደት ለመስከት ለመስከት

END 1) ATE FILMED 6-1988 DTic